

# Imperial Solar Energy Center West

## Appendix D

---

### Geotechnical Investigative Report

*Prepared by Landmark Consultants, Inc.*

*May 2010*

# **Geotechnical Investigation Report**

## **Imperial Solar Energy Center West**

Dunaway Road and I-8 Freeway  
Imperial County, California

---

Prepared for:

**CSOLAR Development, LLC**  
1144 N. 115<sup>th</sup> Street, Suite 400  
Omaha, NE 68154



---

Prepared by:

**LANDMARK**  
Geo-Engineers and Geologists

**Landmark Consultants, Inc.**  
780 N. 4<sup>th</sup> Street  
El Centro, CA 92243  
(760) 370-3000

**May 2010**



780 N. 4th Street  
El Centro, CA 92243  
(760) 370-3000  
(760) 337-8900 fax

77-948 Wildcat Drive  
Palm Desert, CA 92211  
(760) 360-0665  
(760) 360-0521 fax

May 26, 2010

Mr. Steve Johnson  
CSOLAR Development, LLC  
1144 N. 115<sup>th</sup> Street, Suite 400  
Omaha, NE 68154

**Geotechnical Investigation  
Proposed Imperial Solar Energy Center West  
Dunaway Road and I-8 Freeway  
Imperial County, California  
*LCI Report No. LE10093***

Dear Mr. Johnson:

This geotechnical report is provided for permitting, design and construction of the proposed CSOLAR Imperial Solar Energy Center West project located east of Dunaway Road on both sides of the I-8 Freeway approximately 12 miles west of El Centro, California. Our geotechnical investigation was conducted in response to your request for our services. The enclosed report describes our soil engineering investigation and presents our professional opinions regarding geotechnical conditions at the site to be considered in the design and construction of the project.

This executive summary presents *selected* elements of our findings and recommendations only. This summary *does not* present all details needed for the proper application of our findings and recommendations. Our findings, recommendations, and application options are related *only through reading the full report*, and are best evaluated with the active participation of the engineer of record who developed them. The findings of this study are summarized below:

- Sand soils (SM) predominate the site. Clay soils were encountered in the southeastern 300 acres of the project site.
- Foundation designs for buildings located in the southeast portion of the site will be required to mitigate expansive soil conditions by one of the following methods:
  1. Remove and replace upper 3.0 feet of clay soils with non-expansive sands.
  2. Design foundations to resist expansive forces in accordance with the 2007 California Building Code (CBC) Chapter 18, Section 1805 or the Post-Tensioning Institute, 2004 method. This requires grade-beam stiffened floor slabs (18 feet maximum on center) or post tensioned floor slabs. Design soil bearing pressure = 1,500 psf.




- The risk of liquefaction induced settlement is low (estimated settlement of 0 to 1 inch at a depth of 30 feet below ground surface).
- The clay soils are aggressive to concrete and steel. The sands/silts onsite have low sulfates and chlorides which indicate that those soils are no aggressive to concrete. Concrete mixes shall have a maximum water cement ratio of 0.45 and a minimum compressive strength of 4,500 psi (minimum of 6 sacks Type II/V cement per cubic yard).
- All soils exhibit a low resistivity which indicates a severe corrosion potential to steel.
- All reinforcing bars, anchor bolts and hold downs shall have a minimum concrete cover of 3.0 inches. No hold-down straps are allowed at the foundation perimeter.
- The sand soils are absorptive and acceptable for onsite sewage disposal systems or for infiltration of stormwater.


We did not encounter soil conditions that would preclude development of the proposed project provided the recommendations contained in this report are implemented in the design and construction of this project.

We appreciate the opportunity to provide our findings and professional opinions regarding geotechnical conditions at the site. If you have any questions or comments regarding our findings, please call our office at (760) 370-3000.

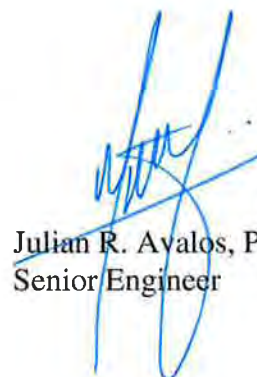
Respectfully Submitted,  
**Landmark Consultants, Inc.**

  
Steven K. Williams, CEG  
Senior Engineering Geologist



  
Jeffrey O. Lyon, PE  
President



  
Julian R. Avalos, PE  
Senior Engineer



Distribution:  
Client (4)

TABLE OF CONTENTS

	Page
Section 1.....	1
INTRODUCTION.....	1
1.1 Project Description.....	1
1.2 Purpose and Scope of Work.....	1
1.3 Authorization .....	3
Section 2.....	4
METHODS OF INVESTIGATION.....	4
2.1 Field Exploration .....	4
2.2 Laboratory Testing .....	5
Section 3.....	6
DISCUSSION .....	6
3.1 Site Conditions.....	6
3.2 Geologic Setting.....	7
3.3 Seismicity and Faulting.....	7
3.4 Site Acceleration and CBC Seismic Coefficients .....	9
3.5 Subsurface Soil .....	10
3.6 Groundwater .....	11
3.7 Liquefaction .....	11
Section 4.....	14
RECOMMENDATIONS .....	14
4.1 Site Preparation.....	14
4.2 Foundations and Settlements .....	16
4.3 Drilled Piers .....	17
4.4 Driven Steel Piles.....	18
4.5 Slabs-On-Grade.....	19
4.6 Concrete Mixes and Corrosivity .....	20
4.7 Seismic Design.....	22
4.8 Pavements .....	22
Section 5.....	25
LIMITATIONS .....	25
5.1 Limitations .....	25
5.2 Additional Services.....	26

APPENDIX A: Vicinity and Site Maps

APPENDIX B: Subsurface Soil Logs and Soil Key

APPENDIX C: Laboratory Test Results

APPENDIX D: Liquefaction Analysis Results

APPENDIX E: References

Section 1

**INTRODUCTION**

**1.1 Project Description**

This report presents the findings of our geotechnical investigation for the proposed Imperial Solar Energy Center West project located east of Dunaway Road on both sides of the I-8 Freeway approximately 12 miles west of El Centro, California (See Vicinity Map, Plate A-1). The proposed project will consist of approximately 1,130 acres of PV solar panels mounted on steel racks supported by short piers, shallow driven piles or shallow spread footings. Also, the proposed solar energy facility will have maintenance/storage building(s), inverter stations, and an electrical substation. The photovoltaic modules will be ground mounted on single axis trackers or fixed mount structures. A site plan for the proposed development was not made available to us at the time that this report was prepared.

The small office and maintenance/storage building is planned to consist of slab-on-grade foundation with steel frame and/or wood-frame construction. Footing loads at exterior bearing walls are estimated at 1 to 5 kips per lineal foot. Column loads are estimated to range from 5 to 30 kips. If structural loads exceed those stated above, we should be notified so we may evaluate their impact on foundation settlement and bearing capacity. Site development will include minimal site grading, building pad preparation, septic system installation, underground utility installation, and site paving at the O & M building.

**1.2 Purpose and Scope of Work**

The purpose of this geotechnical study was to investigate the upper 50 feet of subsurface soil at selected locations within the site for evaluation of physical/engineering properties. From study of field and laboratory data, professional opinions were developed and are provided in this report regarding geotechnical conditions at this site and the effect on design and construction.

The scope of our services consisted of the following:

- ▶ Field exploration and in-situ testing of the site soils at selected locations and depths.
- ▶ Laboratory testing for physical and/or chemical properties of selected samples.
- ▶ Review of the available literature and publications pertaining to local geology, faulting, and seismicity.
- ▶ Engineering analysis and evaluation of the data collected.
- ▶ Preparation of this report presenting our findings, professional opinions, and recommendations for the geotechnical aspects of project design and construction.

This report addresses the following geotechnical issues:

- ▶ Subsurface soil and groundwater conditions
- ▶ Site geology, regional faulting and seismicity, near source factors, and site seismic accelerations
- ▶ Liquefaction potential and its mitigation
- ▶ Expansive soil and methods of mitigation
- ▶ Aggressive soil conditions to metals and concrete

Professional opinions with regard to the above issues are presented for the following:

- ▶ Site grading and earthwork
- ▶ Building pad and foundation subgrade preparation
- ▶ Allowable soil bearing pressures and expected settlements
- ▶ Typical capacities for drilled piers and driven steel piles
- ▶ Concrete slabs-on-grade
- ▶ Excavation conditions and buried utility installations
- ▶ Mitigation of the potential effects of salt concentrations in native soil to concrete mixes and steel reinforcement
- ▶ Seismic design parameters

Our scope of work for this report did not include an evaluation of the site for the presence of environmentally hazardous materials or conditions, groundwater mounding (due to site applied water), or landscape suitability of the soil.

### **1.3 Authorization**

Authorization to proceed with our work was provided by signed agreement with Tenaska on April 20, 2010. We conducted our work according to our written proposal dated April 2, 2010.



Section 2

**METHODS OF INVESTIGATION**

**2.1 Field Exploration**

Subsurface exploration was performed on April 28 and 29, 2010 using 2R Drilling of Ontario, California to advance fifteen (15) borings to depths of 20 to 50 feet below existing ground surface. The borings were advanced with a truck-mounted, CME 55 drill rig using 8-inch diameter, hollow-stem, continuous-flight augers. The approximate boring locations were established in the field and plotted on the site map by sighting to discernable site features. The boring locations are shown on the Site and Exploration Plan (Plate A-2).

A professional engineer observed the drilling operations and maintained logs of the soil encountered with sampling depths. During drilling soils were visually classified according to the Unified Soil Classification System and relatively undisturbed and bulk samples of the subsurface materials were obtained at selected intervals. The relatively undisturbed soil samples were retrieved using a 2-inch outside diameter (OD) split-spoon sampler or a 3-inch OD Modified California Split-Barrel (ring) sampler. In addition, Standard Penetration Tests (SPT) was performed in accordance with ASTM D1586. The samples were obtained by driving the samplers ahead of the auger tip at selected depths using a 140-pound CME automatic hammer with a 30-inch drop. The number of blows required to drive the samplers the last 12 inches of an 18-inch drive depth into the soil is recorded on the boring logs as “blows per foot”. Blow counts (N values) reported on the boring logs represent the field blow counts. No corrections have been applied for effects of overburden pressure, automatic hammer drive energy, drill rod lengths, liners, and sampler diameter. Pocket penetrometer readings were also obtained to evaluate the stiffness of cohesive soils retrieved from sampler barrels.

After logging and sampling the soil, the exploratory borings were backfilled with the excavated material. The backfill was loosely placed and was not compacted to the requirements specified for engineered fill.

The subsurface logs are presented on Plates B-1 through B-15 in Appendix B. A key to the log symbols is presented on Plate B-16. The stratification lines shown on the subsurface logs represent the approximate boundaries between the various strata. However, the transition from one stratum to another may be gradual over some range of depth.

## **2.2 Laboratory Testing**

Laboratory tests were conducted on selected bulk (auger cuttings) and relatively undisturbed soil samples obtained from the soil boring to aid in classification and evaluation of selected engineering properties of the site soils. The tests were conducted in general conformance to the procedures of the American Society for Testing and Materials (ASTM) or other standardized methods as referenced below. The laboratory testing program consisted of the following tests:

- ▶ Plasticity Index (ASTM D4318) – used for soil classification and expansive soil design criteria
- ▶ Particle Size Analyses (ASTM D422) – used for soil classification and liquefaction evaluation
- ▶ Unit Dry Densities (ASTM D2937) and Moisture Contents (ASTM D2216) – used for insitu soil parameters
- ▶ Direct Shear (ASTM D3080) – used for soil strength determination
- ▶ Unconfined Compression (ASTM D2166) – used for soil strength estimates.
- ▶ Chemical Analyses (soluble sulfates & chlorides, pH, and resistivity) (Caltrans Methods) – used for concrete mix proportions and corrosion protection requirements.

The laboratory test results are presented on the subsurface logs (Appendix B) and on Plates C-1 through C-8 in Appendix C.

Engineering parameters of soil strength, compressibility and relative density utilized for developing design criteria provided within this report were obtained from the field and laboratory testing program.

Section 3  
**DISCUSSION**

**3.1 Site Conditions**

The project site is located east of Dunaway Road on both sides of the I-8 Freeway approximately 12 miles west of El Centro, California. The subject site is bisected by the I-8 Freeway, a divided four-lane freeway between San Diego, California and Tucson, Arizona. The interstate freeway was construction in the mid to late 1960's. It appears that the property had been developed for farming prior to freeway construction.

The site has been leveled for use as agricultural fields with benches of approximately 5 to 10 foot elevation differences between fields on the north and south sides of the freeway. Irrigation water was supplied to the site from the West Side Main Canal (WSM) which forms a portion of the east property boundary. Pumps were used to lift the water from the WSM in a series of canals and pumps (5 total) to the west side of the site where it was distributed to the fields through a series of north-south concrete irrigation ditches.

The site is located at the transition between the agricultural area (east) and undeveloped desert area (west) of the Imperial Valley of western Imperial County, California. Properties to the east consist of agricultural use land across the West Side Main Canal. A small rural farm house was noted east of the site on the south side of the I-8 Freeway. Vacant desert lands are located to the north, south, and west of the site. Desert washes, both to the north and south sides of Interstate 8 Freeway, terminate at the boundaries of the project site.

The project site lies at an elevation of approximately 15 feet above to 30 feet below mean sea level (MSL) (El. 1015 to 970 local datum) in the Imperial Valley region of the California low desert. The surrounding properties lie on terrain which is flat (planar), part of a large agricultural valley, which was previously an ancient lake bed covered with fresh water to an elevation of  $43\pm$  feet above MSL. The beach line ridge of the ancient lake bed lies about 0.5 mile to the west of the project site. Annual rainfall in this arid region is less than 3 inches per year with four months of average summertime temperatures above 100 °F. Winter temperatures are mild, seldom reaching freezing.

### **3.2 Geologic Setting**

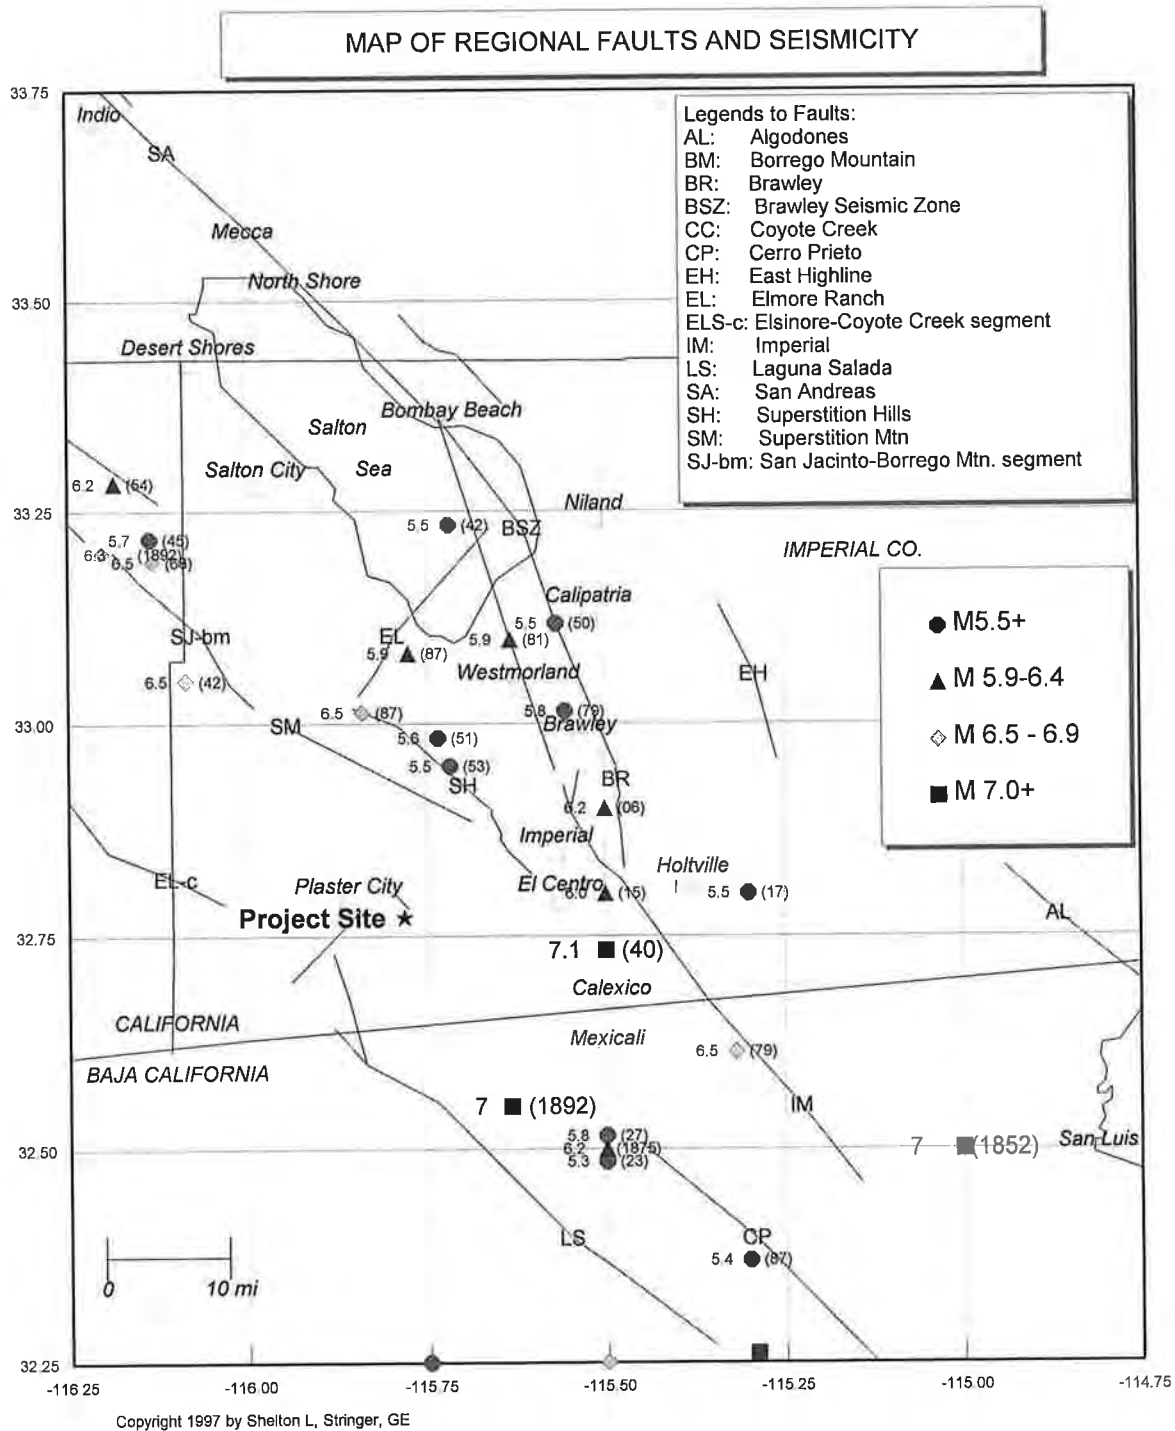
The project site is located in the Imperial Valley portion of the Salton Trough physiographic province. The Salton Trough is a topographic and geologic structural depression resulting from large scale regional faulting. The trough is bounded on the northeast by the San Andreas Fault and Chocolate Mountains and the southwest by the Peninsular Range and faults of the San Jacinto Fault Zone. The Salton Trough represents the northward extension of the Gulf of California, containing both marine and non-marine sediments since the Miocene Epoch. Tectonic activity that formed the trough continues at a high rate as evidenced by deformed young sedimentary deposits and high levels of seismicity. Figure 1 shows the location of the site in relation to regional faults and physiographic features.

The Imperial Valley is directly underlain by lacustrine deposits, which consist of interbedded lenticular and tabular silt, sand, and clay. The Late Pleistocene to Holocene lake deposits are probably less than 100 feet thick and derived from periodic flooding of the Colorado River which intermittently formed a fresh water lake (Lake Cahuilla). The high stand of Lake Cahuilla is at Elevation 45 feet (above sea level) and is located about 0.5 mile west of the southwestern boundary of the project site. The latest high stand occurred approximately 300 years ago as dated by prehistoric Indian fish traps located on the shoreline. Older deposits consist of Miocene to Pleistocene non-marine and marine sediments deposited during intrusions of the Gulf of California and are located to the west of the site. The west boundary of this site lies at about El. 15 feet (MSL).

Basement rock consisting of Mesozoic granite and Paleozoic metamorphic rocks are estimated to exist at depths between 15,000 - 20,000 feet near the center of the basin.

### **3.3 Seismicity and Faulting**

Faulting and Seismic Sources: We have performed a computer-aided search of known faults or seismic zones that lie within a 62 mile (100 kilometer) radius of the project site as shown on Figure 1 and Table 1. The search identifies known faults within this distance and computes deterministic ground accelerations at the site based on the maximum credible earthquake expected on each of the faults and the distance from the fault to the site.



Faults and Seismic Zones from Jennings (1994), Earthquakes modified from Ellsworth (1990) catalog.

**Figure 1. Map of Regional Faults and Seismicity**



**Table 1**  
**FAULT PARAMETERS & DETERMINISTIC**  
**ESTIMATES OF PEAK GROUND ACCELERATION (PGA)**

Fault Name or Seismic Zone	Distance (mi) & Direction from Site	Fault Type	Fault Length (km)	Maximum Magnitude Mmax (Mw)	Avg Slip Rate (mm/yr)	Avg Return Period (yrs)	Date of Last Rupture (year)	Largest Historic Event >5.5M (year)	Est. Site PGA (g)
Reference Notes: (1)		(2) (3)	(2)	(4)	(3)	(3)	(3)	(5)	(6)
<b>Imperial Valley Faults</b>									
Imperial	16 ENE	A B	62	<b>7.0</b>	20	79	1979	7.0 1940	<b>0.18</b>
Brawley Seismic Zone	17 NE	B B	42	<b>6.4</b>	25	24		5.9 1981	<b>0.13</b>
Brawley	18 E	B B	14	<b>7.0</b>	20	---	1979	5.8 1979	<b>0.17</b>
Cerro Prieto	27 SE	A B	116	<b>7.2</b>	34	50	1980	7.1 1934	<b>0.14</b>
East Highline Canal	33 ENE	C C	22	<b>6.3</b>	1	774			<b>0.07</b>
<b>San Jacinto Fault System</b>									
- Superstition Mtn.	9.5 NNE	B A	23	<b>6.6</b>	5	500	1440 +/-		<b>0.22</b>
- Superstition Hills	10 NE	B A	22	<b>6.6</b>	4	250	1987	6.5 1987	<b>0.21</b>
- Elmore Ranch	18 NNW	B A	29	<b>6.6</b>	1	225	1987	5.9 1987	<b>0.13</b>
- Borrego Mtn	21 NW	B A	29	<b>6.6</b>	4	175		6.5 1942	<b>0.12</b>
- Anza Segment	39 NW	A A	90	<b>7.2</b>	12	250	1918	6.8 1918	<b>0.10</b>
- Coyote Creek	40 NW	B A	40	<b>6.8</b>	4	175	1968	6.5 1968	<b>0.08</b>
- Hot Spgs-Buck Ridge	54 NW	B A	70	<b>6.5</b>	2	354		6.3 1937	<b>0.06</b>
- Whole Zone	9.5 NNE	A A	245	<b>7.5</b>	---	---			<b>0.35</b>
<b>Elsinore Fault System</b>									
- Laguna Salada	6.5 WSW	B B	67	<b>7.0</b>	3.5	336		7.0 1891	<b>0.34</b>
- Coyote Segment	14 W	B A	38	<b>6.8</b>	4	625			<b>0.18</b>
- Julian Segment	40 WNW	A A	75	<b>7.1</b>	5	340			<b>0.10</b>
- Earthquake Valley	43 WNW	B A	20	<b>6.5</b>	2	351			<b>0.07</b>
- Whole Zone	14 W	A A	250	<b>7.5</b>	---	---			<b>0.26</b>
<b>San Andreas Fault System</b>									
- Coachella Valley	40 N	A A	95	<b>7.4</b>	25	220	1690 +/-	6.5 1948	<b>0.11</b>
- Whole S. Calif. Zone	40 N	A A	458	<b>7.9</b>	---	---	1857	7.8 1857	<b>0.15</b>

**Notes:**

- Jennings (1994) and CDMG (1996)
- CDMG (1996), where Type A faults -- slip rate >5 mm/yr and well constrained paleoseismic data  
Type B faults -- all other faults.
- WGCEP (1995)
- CDMG (1996) based on Wells & Coppersmith (1994)
- Ellsworth Catalog in USGS PP 1515 (1990) and USBR (1976), Mw = moment magnitude,
- The deterministic estimates of the Site PGA are based on the attenuation relationship of:  
Boore, Joyner, Fumal (1997)

The Maximum Magnitude Earthquake (Mmax) listed was taken from published geologic information available for each fault (Cao, et. al., 2003 and Jennings, 1994).

**Seismic Risk:** The project site is located in the seismically active Imperial Valley of southern California and is considered likely to be subjected to moderate to strong ground motion from earthquakes in the region. The proposed site structures should be designed in accordance with the 2007 California Building Code (CBC) for a “Maximum Considered Earthquake” (MCE) and with the appropriate site coefficients. The MCE is defined as the ground motion having a 2 percent probability of being exceeded in 50 years.

#### **Seismic Hazards.**

- ▶ **Groundshaking.** The primary seismic hazard at the project site is the potential for strong groundshaking during earthquakes along the Imperial, Laguna Salada, and Superstition Hills Faults. A further discussion of groundshaking follows in Section 3.4.
- ▶ **Surface Rupture.** The project site does not lie within a State of California, Alquist-Priolo Earthquake Fault Zone. Surface fault rupture is considered to be unlikely at the project site because of the well-delineated fault lines through the Imperial Valley as shown on USGS and CGS maps.
- ▶ **Liquefaction.** Liquefaction is a potential design consideration because of underlying saturated sandy substrata. The potential for liquefaction at the site is discussed in more detail in Section 3.7.

#### **Other Secondary Hazards.**

- ▶ **Landsliding.** The hazard of landsliding is unlikely due to the regional planar topography. No ancient landslides are shown on geologic maps of the region and no indications of landslides were observed during our site investigation.
- ▶ **Volcanic hazards.** The site is not located in proximity to any known volcanically active area and the risk of volcanic hazards is considered very low.
- ▶ **Tsunamis, seiches, and flooding.** The site does not lie near any large bodies of water, so the threat of tsunami, seiches, or other seismically-induced flooding is unlikely.
- ▶ **Expansive soil.** In general, much of the near surface soils in the Imperial Valley consist of silty clays and clays which are moderate to highly expansive. The expansive soil conditions encountered within the southeastern 300 acres of the site are discussed in more detail in Section 3.5.

### 3.4 Site Acceleration and CBC Seismic Coefficients

Site Acceleration: Ground motions are dependent primarily on the earthquake magnitude and distance to the seismogenic (rupture) zone. Accelerations also are dependent upon attenuation by rock and soil deposits, direction of rupture and type of fault; therefore, ground motions may vary considerably in the same general area. Deterministic horizontal peak ground accelerations (PGA) from maximum probable earthquakes on regional faults have been estimated and are included in Table 1. The deterministic PGA estimate for the project site is based on the ground motion having a 10% probability of being exceeded in 50 years (return period of 475 years).

The computer program FRISKSP (Blake, 2000) was used to obtain the probabilistic and deterministic estimates of the site PGA using the attenuation relationship NEHRP D 250 of Boore, Joyner, and Fumal (1997). The PGA estimate for the Design Basis Earthquake (DBE), defined as an event having a 10% probability of being exceeded in 50 years (return period of 475 years) was estimated to be **0.45g**. The PGA estimate for the Maximum Considered Earthquake (MCE), which is defined as an event having a 2% probability of being exceeded in 50 years (return period of 2,500 years), was estimated to be **0.65g**.

2007 CBC (2006 IBC) Seismic Response Parameters: The 2007 California Building Code (CBC) seismic parameters are based on the Maximum Considered Earthquake for a ground motion with a 2% probability of occurrence in 50 years. This follows the methodology of the 2006 International Building Code (IBC). Table 2 lists the site coefficients and adjusted maximum considered earthquake spectral response acceleration parameters given in Chapter 16 of the CBC. The site soils have been classified as Site Class D (stiff soil profile). Design earthquake ground motions are defined as the earthquake ground motions that are two-thirds (2/3) of the corresponding MCE ground motions. Design earthquake ground motion data are provided in Table 2.

A site-specific ground motion hazard analysis was prepared in accordance with the 2007 CBC Section 1614A.1.2 (Table 3 and Figure 2). The determination of the site specific ground motions was performed in conformance with the guidelines outlined in ASCE 7-05 Section 21 (21.2.1, 21.2.2, and 21.3).

**Table 2**  
**2007 California Building Code (CBC) and ASCE 7-05 Seismic Parameters**

Site Class:	<b>D</b>	<u>IBC Reference</u>
Latitude:	32.7724 N	Table 1613.5.2
Longitude:	-115.7821 W	

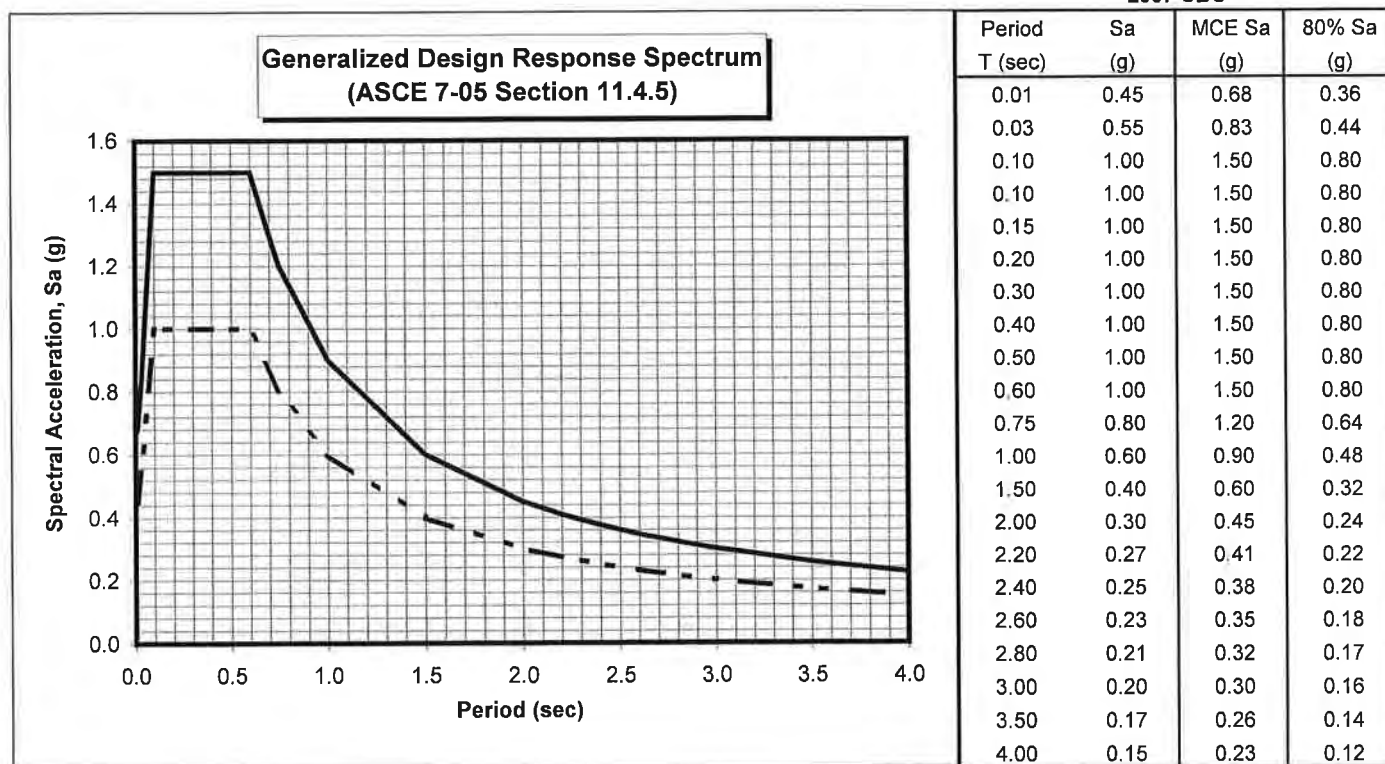
**Maximum Considered Earthquake (MCE) Ground Motion**

Short Period Spectral Response	$S_s$	1.50 g	Figure 1613.5(3)
1 second Spectral Response	$S_1$	0.60 g	Figure 1613.5(4)
Site Coefficient	$F_a$	1.00	Table 1613.5.3 (1)
Site Coefficient	$F_v$	1.50	Table 1613.5.3 (2)
Adjusted Short Period Spectral Response	$S_{MS}$	1.50 g	$= F_a * S_s$
Adjusted 1 second Spectral Response	$S_{M1}$	0.90 g	$= F_v * S_1$

**Design Earthquake Ground Motion**

Short Period Spectral Response	$S_{DS}$	1.00 g	$= 2/3 * S_{MS}$
1 second Spectral Response	$S_{D1}$	0.60 g	$= 2/3 * S_{M1}$
	$T_o$	0.12 sec	$= 0.2 * S_{D1} / S_{DS}$
	$T_s$	0.60 sec	$= S_{D1} / S_{DS}$

**2007 CBC**




 Design Response Spectra  
 MCE Response Spectra

**SITE SPECIFIC GROUND MOTION**  
**Table 3**

PSHA MCE 2% in 50 years		DETERMINISTIC MCE			DETERMINISTIC LOWER LIMIT		DESIGN RESPONSE SPECTRUM	
Period sec	S <sub>aM</sub> g's	Period sec	S <sub>aM</sub> g's	150%S <sub>aM</sub> g's	Period sec	S <sub>aM</sub> g's	Period sec	S <sub>a</sub> g's
0.01	0.65	0.01	0.51	1.50	0.01	1.50	0.01	0.43
0.03	0.65	0.03	0.51	1.50	0.03	1.50	0.03	0.43
0.10	1.03	0.10	0.22	1.50	0.10	1.50	0.10	0.68
0.15	1.33	0.15	1.09	1.64	0.15	1.50	0.15	0.89
0.20	1.48	0.20	1.20	1.81	0.20	1.50	0.20	0.99
0.30	1.55	0.30	1.27	1.90	0.30	1.50	0.30	1.04
0.40	1.47	0.40	1.20	1.80	0.40	1.50	0.40	0.98
0.50	1.35	0.50	1.09	1.64	0.50	1.50	0.50	0.90
0.75	1.04	0.75	0.83	1.24	0.75	1.20	0.75	0.69
1.00	0.84	1.00	0.66	0.98	1.00	0.90	1.00	0.56
1.50	0.65	1.50	0.48	0.73	1.50	0.60	1.50	0.43
2.00	0.56	2.00	0.40	0.61	2.00	0.45	2.00	0.37

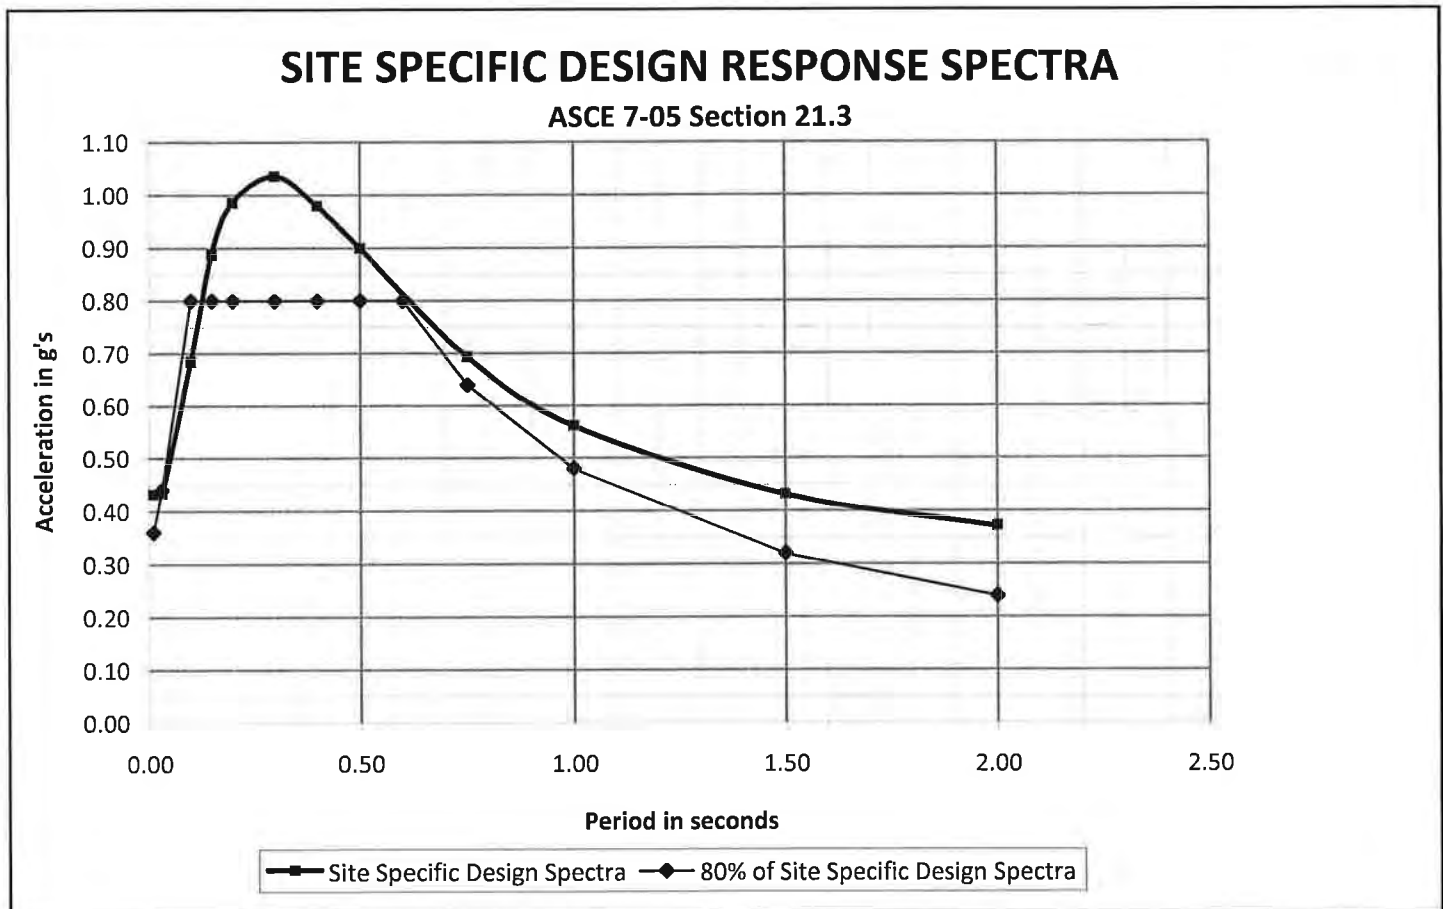
**Figure 2. Site specific design response spectra**



**SITE SPECIFIC DESIGN ACCELERATION PARAMETERS**  
(ASCE 7-05 Section 21.4)

Short Period Spectral Response (S <sub>DS</sub> )	0.99	Adjusted Short Period Spectral Response (S <sub>MS</sub> )	1.48
1 second Spectral Response (S <sub>D1</sub> )	0.74	Adjusted 1 second Spectral Response (S <sub>M1</sub> )	1.12

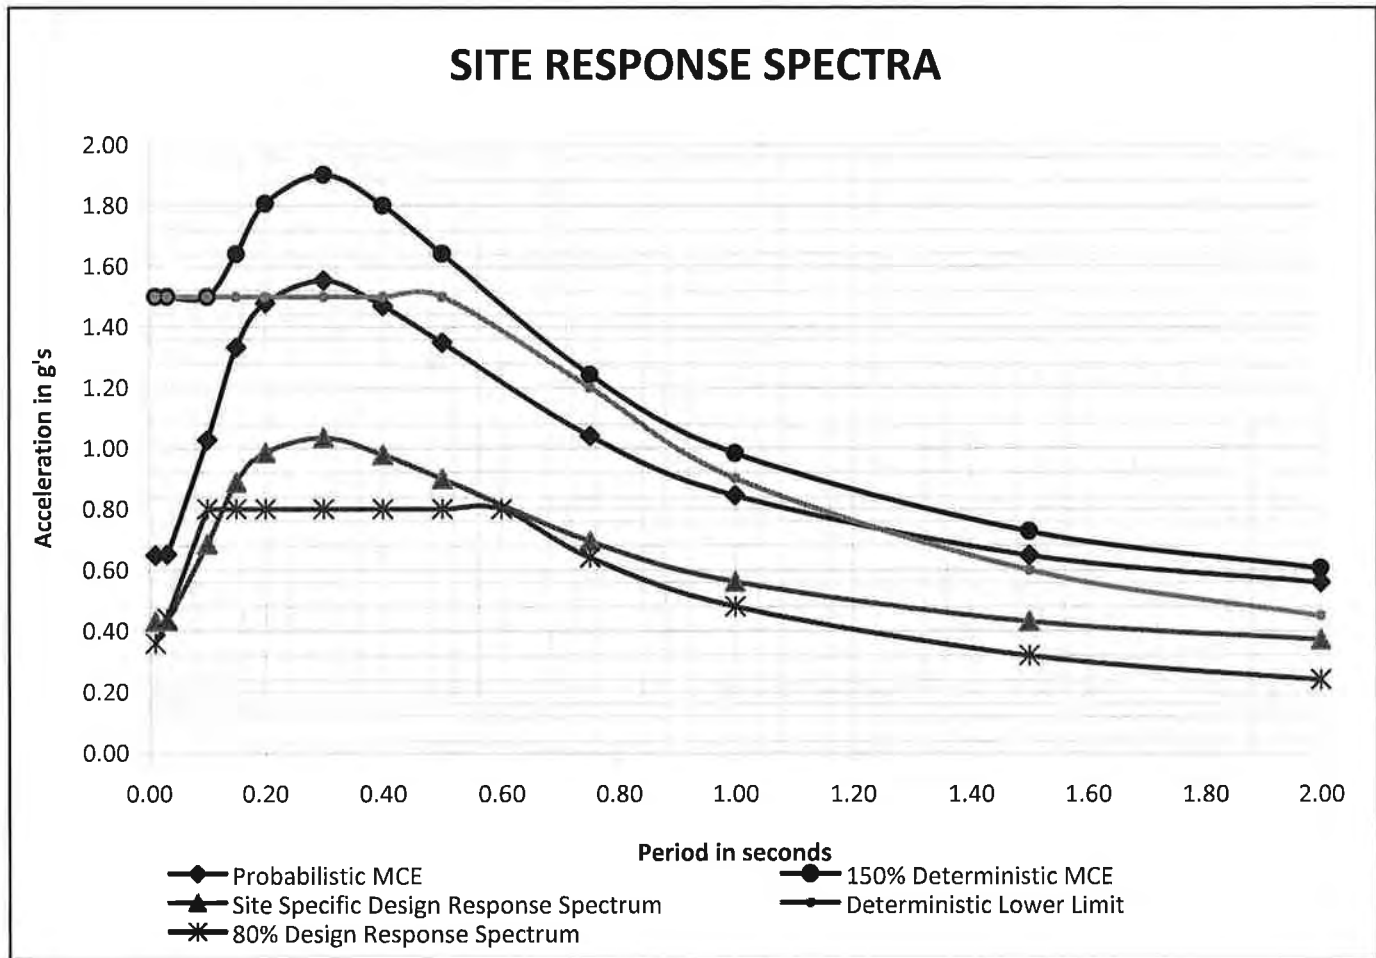

**Figure 3. Ground motion hazard analysis****REFERENCES**

<b>PROBABILISTIC MCE</b>	2% in 50 years (2,500 year Return Period) ASCE 7-05 Section 21.2.1
<b>150% DETERMINISTIC MCE</b>	150% Sum of Maximum Considered Earthquake ASCE 7-05 Section 21.2.2
<b>DETERMINISTIC LOWER LIMIT</b>	Lower Limit Deterministic ASCE 7-05 Section 21.2.2
<b>DESIGN RESPONSE SPECTRUM</b>	ASCE 7-05 Section 21.2.3 and 21.3
<b>80% GENERAL PROCEDURE SPECTRUM</b>	80% $S_a$ 2007 CBC and ASCE 7-05 Section 21.3

A ground motion value of **0.40g** (40% of the  $S_{DS}$  or  $S_{DS}/2.5$ ) was determined for liquefaction and seismic settlement analysis in accordance with California Geological Survey Note 48. The parameter  $S_{DS}$  is derived from the site-specific seismic hazard analysis (ASCE 7-05 Section 21.3) and taken as the spectral acceleration at a period of 0.2 seconds.

### 3.5 Subsurface Soil

Subsurface soils encountered during the field exploration conducted on April 28 and 29, 2010 consist of dominantly of silty sands with interbedded silts and clays in the northwestern portion of the site and interbedded clays and sands in the southeastern 300 acres of the site. The subsurface logs (Plates B-1 through B-15) depict the stratigraphic relationships of the various soil types.

The native surface clays in the southeastern 300 acres exhibit high to very high swell potential (Expansion Index,  $EI = 100$  to  $160$ ) when tested according to Uniform Building Code Standard 18-2 methods. The clay is expansive when wetted and can shrink with moisture loss (drying). Development of building foundations, concrete flatwork, and asphaltic concrete pavements should include provisions for mitigating potential swelling forces and reduction in soil strength, which can occur from saturation of the soil. Causes for soil saturation include landscape irrigation, broken utility lines, or capillary rise in moisture upon sealing the ground surface to evaporation. Moisture losses can occur with lack of landscape watering, close proximity of structures to downslopes and root system moisture extraction from deep rooted shrubs and trees placed near the foundations. Typical measures used for light industrial projects to remediate expansive soil include:

- ▶ replacement of expansive silts/clays with non-expansive sands or silts,
- ▶ moisture conditioning subgrade soils to a minimum of 5% above optimum moisture (ASTM D1557) within the drying zone of surface soils,
- ▶ design of foundations that are resistant to shrink/swell forces of silt/clay soil.

### 3.6 Groundwater

Groundwater encountered in the borings ranged in depth from about 15 to 49 feet during the time of exploration. Groundwater levels are shallower along the east side of the site adjacent to the unlined (earthen) West Side Main Canal (approximately 8 to 10 feet below ground surface). Groundwater levels deepen towards the west away from the canal. There is uncertainty in the accuracy of short-term water level measurements, particularly in fine-grained soil. Groundwater levels may fluctuate with precipitation, irrigation of adjacent properties, site landscape watering, drainage, and site grading. The referenced groundwater level should not be interpreted to represent an accurate or permanent condition.

### 3.7 Liquefaction

Liquefaction occurs when granular soil below the water table is subjected to vibratory motions, such as produced by earthquakes. With strong ground shaking, an increase in pore water pressure develops as the soil tends to reduce in volume. If the increase in pore water pressure is sufficient to reduce the vertical effective stress (suspending the soil particles in water), the soil strength decreases and the soil behaves as a liquid (similar to quicksand). Liquefaction can produce excessive settlement, ground rupture, lateral spreading, or failure of shallow bearing foundations.

Four conditions are generally required for liquefaction to occur:

- (1) the soil must be saturated (relatively shallow groundwater);
- (2) the soil must be loosely packed (low to medium relative density);
- (3) the soil must be relatively cohesionless (not clayey); and
- (4) groundshaking of sufficient intensity must occur to function as a trigger mechanism.

All of these conditions exist to some degree at this site.

Methods of Analysis: Liquefaction potential at the project site was evaluated using the 1997 NCEER Liquefaction Workshop methods. The 1997 NCEER methods utilize direct SPT blow counts or CPT cone readings from site exploration and earthquake magnitude/PGA estimates from the seismic hazard analysis.

The resistance to liquefaction is plotted on a chart of cyclic shear stress ratio (CSR) versus a corrected blow count  $N_{1(60)}$  or  $Q_{c1N}$ . A ground acceleration of 0.40g was used in the analysis with a varying groundwater depth.

Liquefaction induced settlements have been estimated using the 1987 Tokimatsu and Seed method. The fines content of liquefiable sands and silts increases the liquefaction resistance in that more ground motion cycles are required to fully develop increased pore pressures. Prior to calculating the settlements, the field SPT blow counts were corrected to account for the type of hammer, borehole diameter, overburden pressure and rod length  $N_{1(60)}$  in accordance with Robertson and Wride (1997).

The soil encountered at the points of exploration included saturated silts and silty sands that could liquefy during a CBC Design Basis Earthquake. Liquefaction can occur within isolated silt and sand layers between depths of 22 to 36 feet. The likely triggering mechanism for liquefaction appears to be strong groundshaking associated with the rupture of the Imperial Fault, Laguna Salada Fault, and possibly the Cerro Prieto Fault. The analysis is summarized in the table below.

#### SUMMARY OF LIQUEFACTION ANALYSES

Boring Location	Depth To First Liquefiable Zone (ft)	Potential Induced Settlement (in)
B-5	30	1
B-7	--	0
B-8	--	0
B-15	--	0

Liquefaction Induced Settlements: ***Based on empirical relationships, total induced settlements are estimated to be about 1 inch should liquefaction occur.*** The magnitude of potential liquefaction induced differential settlement is estimated to be two-thirds of the total potential settlement in accordance with California Special Publication 117; therefore, there is a potential for  $\frac{3}{4}$  inch of liquefaction induced differential settlement at the project site.

Since the potentially liquefiable sandy soils are overlain by 30 feet of non-liquefying soil which resist groundwater movement, it is unlikely that the light structure loads planned are sufficient to result in liquefaction induced settlement greater than the surrounding land mass.

**Liquefaction Induced Ground Failure:** Based on research from Ishihara (1985) and Youd and Garriss (1995) ground rupture or sand boil formation is unlikely because of the thickness of the overlying unliquefiable soil. Sand boils are conical piles of sand derived from the upward flow of groundwater caused by excess porewater pressures created during strong ground shaking. Sand boils are not inherently damaging by themselves, but are an indication that liquefaction occurred at depth (Jones, 2003). Liquefaction induced lateral spreading is not expected to occur at this site due to the planar topography.

**Mitigation:** Liquefaction mitigation measures are not required for structures such as PV module piles and distributed inverter stations because the differential settlement of those structures is small and not expected to result in loss of integrity or functionality.



Section 4

**RECOMMENDATIONS**

**4.1 Site Preparation**

Clearing and Grubbing: All surface improvements, debris or vegetation including grass, trees, and weeds on the site at the time of construction should be removed from the construction area. Root balls should be completely excavated. Organic strippings should be stockpiled and not used as engineered fill. All trash, construction debris, concrete slabs, old pavement, landfill, and buried obstructions such as old foundations and utility lines exposed during rough grading should be traced to the limits of the foreign material by the grading contractor and removed under the supervision of the Geotechnical Engineer. Any excavations resulting from site clearing should be sloped to a bowl shape to the lowest depth of disturbance and backfilled under the observation of the geotechnical engineer's representative.

Building Pad Preparation: The soil within the building pad/foundation areas should be removed to 36 inches below the building pad elevation or existing natural surface grade (whichever is lower) extending five feet beyond all exterior wall/column lines (including concreted areas adjacent to the building). If clay soils exist within the building pad excavation, the clays should not be reused for the building support pad. Exposed subgrade at the bottom of removals should be scarified to a depth of 8 inches, uniformly moisture conditioned to 5 to 10% above optimum moisture content (clays) or  $\pm 2\%$  above optimum (sands), and recompact to 85 to 90% (clays) or a minimum of 90% (sands) of the maximum density determined in accordance with ASTM D1557 methods.

The native sandy soil is suitable for use as engineered fill provided it is free from concentrations of organic matter or other deleterious material. The sandy fill soil should be uniformly moisture conditioned by discing and watering to the limits specified above, placed in maximum 8-inch lifts (loose), and compacted to the limits specified above. Clay soil should not be incorporated into the building support pad.

Import soil for the building support pad (if used) shall be non-expansive, granular soil meeting the USCS classifications of SM, SP-SM, or SW-SM with a maximum rock size of 3 inches and 5 to 35% passing the No. 200 sieve. The geotechnical engineer should approve imported fill soil sources before hauling material to the site.

Imported granular fill should be placed in lifts no greater than 8 inches in loose thickness and compacted to a minimum of 90% of ASTM D1557 maximum dry density at optimum moisture  $\pm 2\%$ .

In areas other than the building pad which are to receive area concrete slabs, the ground surface should be presaturated to a minimum depth of 24 inches and then scarified to 8 inches, moisture conditioned to a minimum of 5% over optimum, and recompact to 83-87% of ASTM D1557 maximum density just prior to concrete placement.

On-site soil free of debris, vegetation, and other deleterious matter may be suitable for use as utility trench backfill above pipezone, but may be difficult to uniformly maintain at specified moistures and compact to the specified densities. Native backfill should only be placed and compacted after encapsulating buried pipes with suitable granular bedding materials and pipe envelope material.

Onsite sandy soil material is acceptable for backfill of utility trenches.

Backfill soil of utility trenches within paved areas should be placed in layers not more than 6 inches in thickness and mechanically compacted to a minimum of 90% of the ASTM D1557 maximum dry density.

Observation and Density Testing: All site preparation and fill placement should be continuously observed and tested by a representative of a qualified geotechnical engineering firm. Full-time observation services during the excavation and scarification process is necessary to detect undesirable materials or conditions and soft areas that may be encountered in the construction area. The geotechnical firm that provides observation and testing during construction shall assume the responsibility of "*geotechnical engineer of record*" and, as such, shall perform additional tests and investigation as necessary to satisfy themselves as to the site conditions and the recommendations for site development.

## 4.2 Foundations and Settlements

Shallow spread footings are suitable to support the new office/ maintenance building. Footings shall be founded on compacted building support fill soils. The foundations may be designed using an allowable soil bearing pressure of 2,000 psf for compacted sands. The allowable soil pressure may be increased by 20% for each foot of embedment depth in excess of 18 inches and by one-third for short term loads induced by winds or seismic events. The maximum basic allowable soil pressure at increased embedment depths shall not exceed 3,500 psf. Foundations should be designed for a maximum deflection of  $L/480$ .

Flat Plate Structural Mats: Flat plate structural mats may be used to mitigate expansive soils at the project site. The structural mat shall have a double mat of steel (minimum No. 4's @ 12" O.C. each way – top and bottom) and a minimum thickness of 12 inches. Mat edges shall have a minimum edge footing of 12 inches width and 18 inches depth (below the building pad surface). Mats may be designed by CBC Chapter 18, Section 1805.8.2 methods using an Effective Plasticity Index of 34.

Structural mats may be designed for a modulus of subgrade reaction ( $K_s$ ) of 100 pci when placed on compacted clay or a subgrade modulus of 300 pci when placed on 3.0 feet of granular fill. Mats shall overlay 2 inches of sand and a 10-mil polyethylene vapor retarder. The building support pad shall be moisture conditioned and recompact as specified in Section 4.1 of this report.

All exterior footings should be embedded a minimum of 18 inches below the building support pad or lowest adjacent final grade, whichever is deeper. Embedment depth of interior footings should be a minimum of 12 inches deep. Interior footing embedment depths shall be determined by the structural engineer/designer and should be sufficient to limit differential movement to 1.0 inch or less. Continuous wall footings should have a minimum width of 12 inches. Spread footings should have a minimum dimension of 24 inches and should be structurally tied to perimeter footings or grade beams. Recommended concrete reinforcement and sizing for all footings should be provided by the structural engineer.

Resistance to horizontal loads will be developed by passive earth pressure on the sides of footings and frictional resistance developed along the bases of footings and concrete slabs. Passive resistance to lateral earth pressure may be calculated using an equivalent fluid pressure of 250 pcf clays or 300 pcf for sands to resist lateral loadings. The top one foot of embedment should not be considered in computing passive resistance unless the adjacent area is confined by a slab or pavement. An allowable friction coefficient of 0.25 clays or 0.35 for sands may also be used at the base of the footings to resist lateral loading.

Foundation movement under the estimated static (non-seismic) loadings and static site conditions are estimated to not exceed 1 inch with differential movement of about two-thirds of total movement for the loading assumptions stated above when the subgrade preparation guidelines given above are followed. Seismically induced liquefaction settlement of the surrounding land mass and structure may be on the order of 1.0 inches.

### 4.3 Drilled Piers

Individual short piers should be adequate to support the solar panels. Embedment depth for short piers to resist lateral loads where no-constraint is provided at ground surface may be designed using the following formula per 2007 CBC Section 1805.7.2.1:

$$d = A/2 [1 + (1+4.36h/A)^{1/2}]$$

where:

$$A = 2.34P/S_1b$$

$b$  = Pier diameter in feet

$d$  = Embedment depth in feet (but not over 12 feet for purpose of computing lateral pressure)

$h$  = Distance in feet from ground surface to point of application of “P”

$P$  = Applied lateral force in pounds

$S_1$  = Allowable lateral soil bearing pressure (basic value of 150 psf/f (see 2007 CBC Table 1804.2). Isolated piers such solar panel short piers that are not adversely affected by a 0.5 inch motion at the ground surface due to short-term lateral loads are permitted to be designed using lateral soil bearing pressures equal to two times the provided value.

The short pier foundations may be designed using an allowable soil bearing pressure of 1,500 psf for the native soils.

#### 4.4 Driven Steel Piles

The use of driven steel piles requires special provisions for corrosion protection due to the corrosive nature of the subsurface soils. Precast, prestressed concrete piles are often used in the corrosive soil environments of the Imperial Valley. Selection of pile type may be based on drivability and cost comparisons.

The specified tip elevation (5 and 10 feet) and design load for a 6-inch driven steel circular pipe pile are given in Table 4.

**TABLE 4**  
**Allowable Capacities of Pile Foundations**

Pile Type: Specified Tip Depth (ft):	Driven Circular Steel Pile (Diameter = 6")	
	5 feet	10 feet
Pile Diameter:	6"	6"
Allowable Axial Capacity (tons) – FS=2.5:	5.8	10.5
Allowable Uplift Capacity (tons) – FS=2.5:	5.9	11.9
Allowable Lateral Capacity (tons) for 1 inch deflection:		
Free Head Condition (kips):	7.1	8.8
Fixed Head Condition (kips):	14.8	17.6
Maximum Moments from Lateral Load,		
Free Head Condition (ft-kips):	7.9	12.1
Fixed Head Condition (ft-kips):	-28.3	-31.0
Depth of Maximum Moment,		
Free Head (ft):	2.1	2.6
Fixed Head (ft):	0	0

Recommendations for other pile types and sizes can be made available upon request.



Lateral Capacity: The allowable lateral capacity is based on a deflection of one-quarter inch at the top of the pile. If greater deflection can be tolerated, lateral load capacity can be increased directly in proportion to a maximum of one inch deflection.

Settlement: Total settlements of less than ¼ inch, and differential movement of about two-thirds of total movement for single piles designed according to the preceding recommendations. If pile spacing is at least 2.5 pile diameters center-to-center, no reduction in axial load capacity is considered necessary for a group effect.

#### **4.5 Slabs-On-Grade**

Concrete slabs and flatwork placed on the building support pad over native clay soil should be a minimum of 5 inches thick due to expansive soil conditions (minimum 6-inch thick where the slab is subjected to wheel loads). Concrete floor slabs shall be monolithically placed with the footings (no cold joints). The concrete slabs should be underlain by a 10-mil polyethylene vapor retarder that works as a capillary break to reduce moisture migration into the slab section. The vapor retarder should be properly lapped and continuously sealed and extend a minimum of 12 inches into the footing excavations. The vapor retarder should be overlain by 2 inches of clean sand (Sand Equivalent SE>30). Concrete slabs may be placed without a sand cover directly over a 15-mil vapor retarder (Stego-Wrap or equivalent).

Concrete slab and flatwork reinforcement should consist of chaired rebar slab reinforcement (minimum of No. 3 bars at 18-inch centers, both horizontal directions) placed at slab mid-height to resist potential swell forces and cracking.

Slab thickness and steel reinforcement are minimums only and should be verified by the structural engineer/designer knowing the actual project loadings. All steel components of the foundation system should be protected from corrosion by maintaining a 3-inch minimum concrete cover of densely consolidated concrete at footings (by use of a vibrator). The construction joint between the foundation and any mowstrips/sidewalks placed adjacent to foundations should be sealed with a polyurethane based non-hardening sealant to prevent moisture migration between the joint.

Epoxy coated embedded steel components or permanent waterproofing membranes placed at the exterior footing sidewall may also be used to mitigate the corrosion potential of concrete placed in contact with native soil.

Control joints should be provided in all concrete slabs-on-grade at a maximum spacing (in feet) of 2 to 3 times the slab thickness (in inches) as recommended by American Concrete Institute (ACI) guidelines. All joints should form approximately square patterns to reduce randomly oriented contraction cracks. Contraction joints in the slabs should be tooled at the time of the pour or sawcut ( $\frac{1}{4}$  of slab depth) within 6 to 8 hours of concrete placement. Construction (cold) joints in foundations and area flatwork should either be thickened butt-joints with dowels or a thickened keyed-joint designed to resist vertical deflection at the joint. All joints in flatwork should be sealed to prevent moisture, vermin, or foreign material intrusion. Precautions should be taken to prevent curling of slabs in this arid desert region (refer to ACI guidelines).

All independent flatwork (sidewalks, patios) should be placed on a minimum of 2 inches of concrete sand or aggregate base, dowelled to the perimeter foundations where adjacent to the building and sloped 2% or more away from the building. A minimum of 24 inches of moisture conditioned (5% minimum above optimum) and 8 inches of compacted subgrade (83 to 87%) should underlie all independent flatwork. Flatwork which contains steel reinforcing (except wire mesh) should be underlain by a 10-mil (minimum) polyethylene separation sheet and at least a 2-inch sand cover. All flatwork should be jointed in square patterns and at irregularities in shape at a maximum spacing of 10 feet or the least width of the sidewalk.

#### **4.6 Concrete Mixes and Corrosivity**

Selected chemical analyses for corrosivity were conducted on bulk samples of the near surface soil from the project site (Plates C-5 and C-6). The native sand soils were found to have low levels of sulfate ion concentration, but clay soils have severe levels. Sulfate ions in high concentrations can attack the cementitious material in concrete, causing weakening of the cement matrix and eventual deterioration by raveling.

The California Building Code recommends that increased quantities of Type II Portland Cement be used at a low water/cement ratio when concrete is subjected to moderate sulfate concentrations. Type V Portland Cement is recommended when the concrete is subjected to soil with severe sulfate concentration.

A minimum of 6.0 sacks per cubic yard of concrete (4,500 psi) of Type V Portland Cement with a maximum water/cement ratio of 0.45 (by weight) should be used for concrete placed in contact with native clay soil on this project (sitework including sidewalks, driveways, patios, and foundations). Admixtures may be required to allow placement of this low water/cement ratio concrete. Concrete placed on native sands/silts do not have special concrete provisions.

The native sandy soil has low levels of chloride ion concentration, but clay soils have severe levels. Chloride ions can cause corrosion of reinforcing steel, anchor bolts and other buried metallic conduits. Resistivity determinations on the soil indicate very severe potential for metal loss because of electrochemical corrosion processes. Mitigation of the corrosion of steel can be achieved by using steel pipes coated with epoxy corrosion inhibitors, asphaltic and epoxy coatings, cathodic protection or by encapsulating the portion of the pipe lying above groundwater with a minimum of 3 inches of densely consolidated concrete. ***No metallic water pipes or conduits should be placed below foundations.***

Foundation designs shall provide a minimum concrete cover of three (3) inches around steel reinforcing or embedded components (anchor bolts, etc.) exposed to native soil or landscape water (to 18 inches above grade). If the 3-inch concrete edge distance cannot be achieved, all embedded steel components (anchor bolts, etc.) shall be epoxy dipped for corrosion protection or a corrosion inhibitor and a permanent waterproofing membrane shall be placed along the exterior face of the exterior footings. ***Hold-down straps should not be used at foundation edges due to corrosion of metal at its protrusion from the slab edge.*** Additionally, the concrete should be thoroughly vibrated at footings during placement to decrease the permeability of the concrete.

All copper piping within 18 inches of ground surface shall be wrapped with two layers of 10 mil plumbers tape or sleeved with PVC piping to prevent contact with soil. The trap primer pipe shall be completely encapsulated in a PVC sleeve and Type K copper should be utilized if polyethylene tubing cannot be used.

Fire protection piping (risers) should be placed outside of the building foundation.

#### **4.7 Seismic Design**

This site is located in the seismically active southern California area and the site structures are subject to strong ground shaking due to potential fault movements along the Laguna Salada, Superstition Hills, and Imperial Faults. Engineered design and earthquake-resistant construction are the common solutions to increase safety and development of seismic areas. Designs should comply with the latest edition of the CBC for Site Class D using the seismic coefficients given in Section 3.4 of this report.

#### **4.8 Pavements**

Pavements should be designed according to CALTRANS or other acceptable methods. Traffic indices were not provided by the project engineer or owner; therefore, we have provided structural sections for several traffic indices for comparative evaluation. The public agency or design engineer should decide the appropriate traffic index for the site. Maintenance of proper drainage is necessary to prolong the service life of the pavements. The site is dominated by surficial sands in the northwestern portion of the site and clay soils in the southeastern portion of the site. Pavement structural sections have been provided for each soil type.

Based on the current State of California CALTRANS method, an estimated R-value of 40 for the sandy soils and 5 for the clay soils and assumed traffic indices, the following tables provides our estimates for asphaltic concrete (AC) and Portland Cement Concrete (PCC) pavement sections.

All weather access roads should consist of a minimum of 6 inches of Caltrans Class 2 aggregate base placed over 12 inches of moisture conditioned (minimum 4% above optimum if clays) native clay soil compacted to a minimum of 90% (95% if sand subgrade) of the maximum dry density determined by ASTM D1557.

### RECOMMENDED PAVEMENTS SECTIONS (CLAY SOILS)

R-Value of Subgrade Soil - 5 (estimated)

Design Method - CALTRANS 2006

Traffic Index (assumed)	Flexible Pavements		(*) Flexible Pavements	
	Asphaltic Concrete Thickness (in.)	Aggregate Base Thickness (in.)	Asphaltic Concrete Thickness (in.)	Aggregate Base/Lime Thickness (in.)
4.0	3.0	6.5	3.0	4.0/14.0
5.0	3.0	9.0	3.0	4.0/15.0
6.0	3.0	14.0	3.0	6.0/18.0
6.5	4.0	14.0	4.0	6.0/18.0
8.0	4.0	18.0	4.0	8.0/21.0
10.0	4.5	26.0	4.5	13.0/24.0
11.0	5.5	28.0	5.5	15.0/24.0

(\*) Pavement structural section when used with 12 inches of lime-treated subgrade soil (3-6% quicklime by weight) compacted to 95% minimum with minimum Unconfined Compressive Strength of 55 psi.

Notes:

- Asphaltic concrete shall be Caltrans, Type B, ¾ inch maximum (½ inch maximum for parking areas), medium grading with PG64-16 asphalt cement, compacted to a minimum of 95% of the Hveem density (CAL 366).
- Aggregate base shall conform to Caltrans Class 2 (¾ in. maximum), compacted to a minimum of 95% of ASTM D1557 maximum dry density.
- Place pavements on 12 inches of moisture conditioned (minimum 4% above optimum if clays) native clay soil compacted to a minimum of 90% (95% if sand subgrade) of the maximum dry density determined by ASTM D1557. No additional subgrade preparation is required for soil-lime mixtures.
- Typical Street Classifications (Imperial County)
 

Parking Areas:	TI = 4.0
Cul-de-Sacs:	TI = 5.0
Local Streets:	TI = 6.0
Minor Collectors:	TI = 6.5
Major Collectors:	TI = 8.0
Minor Arterial:	TI = 10.0
Primary Arterial:	TI = 11.0

### PAVEMENT STRUCTURAL SECTIONS (SAND SOILS)

R-Value of Subgrade Soil - 40

Design Method - CALTRANS 2006

Traffic Index (assumed)	Flexible Pavements		Rigid (PCC) Pavements	
	Asphaltic Concrete Thickness (in.)	Aggregate Base Thickness (in.)	Concrete Thickness (in.)	Aggregate Base Thickness (in.)
4.0	3.0	4.0	5.0	4.0
5.0	3.0	4.0	5.0	4.0
6.0	3.0	6.0	5.5	4.0
7.0	3.5	8.0	6.0	6.0
8.0	3.5	10.0	7.0	6.0
9.0	4.0	12.0	7.5	6.0
10.0	4.5	14.0	8.0	6.0

Notes:

- Asphaltic concrete shall be Caltrans, Type B, ¾ inch maximum (½ inch maximum for parking areas), medium grading with PG64-16 asphalt cement, compacted to a minimum of 95% of the Hveem density (CAL 366).
- Aggregate base shall conform to Caltrans Class 2 (¾ in. maximum), compacted to a minimum of 95% of ASTM D1557 maximum dry density.
- Place pavements on 12 inches of moisture conditioned (minimum of optimum moisture) native sandy silt soil compacted to a minimum of 95% of the maximum dry density determined by ASTM D1557.
- Portland cement concrete for pavements should have Type V cement, a minimum compressive strength of 4,000 psi at 28 days, and a maximum water-cement ratio of 0.50.
- Typical Street Classifications (Imperial County)
 

Parking Areas:	TI = 4.0
Cul-de-Sacs:	TI = 5.0
Local Streets:	TI = 6.0
Minor Collectors:	TI = 6.5
Major Collectors:	TI = 8.0
Minor Arterial:	TI = 10.0
Primary Arterial:	TI = 11.0

## Section 5 **LIMITATIONS**

### **5.1 Limitations**

The recommendations and conclusions within this report are based on current information regarding the proposed Imperial Solar Energy Center West project located east of Dunaway Road on both sides of the I-8 Freeway approximately 12 miles west of El Centro, California. The conclusions and recommendations of this report are invalid if:

- ▶ Structural loads change from those stated or the structures are relocated.
- ▶ The Additional Services section of this report is not followed.
- ▶ This report is used for adjacent or other property.
- ▶ Changes of grade or groundwater occur between the issuance of this report and construction other than those anticipated in this report.
- ▶ Any other change that materially alters the project from that proposed at the time this report was prepared.

Findings and recommendations in this report are based on selected points of field exploration, geologic literature, laboratory testing, and our understanding of the proposed project. Our analysis of data and recommendations presented herein are based on the assumption that soil conditions do not vary significantly from those found at specific exploratory locations. Variations in soil conditions can exist between and beyond the exploration points or groundwater elevations may change. If detected, these conditions may require additional studies, consultation, and possible design revisions.

***This report contains information that may be useful in the preparation of contract specifications. However, the report is not worded in such a manner that we recommend its use as a construction specification document without proper modification. The use of information contained in this report for bidding purposes should be done at the contractor's option and risk.***

This report was prepared according to the generally accepted *geotechnical engineering standards of practice* that existed in Imperial County at the time the report was prepared. No express or implied warranties are made in connection with our services.



This report should be considered invalid for periods after two years from the report date without a review of the validity of the findings and recommendations by our firm, because of potential changes in the Geotechnical Engineering Standards of Practice.

The client has responsibility to see that all parties to the project including, designer, contractor, and subcontractor are made aware of this entire report. The use of information contained in this report for bidding purposes should be done at the contractor's option and risk.

## 5.2 Additional Services

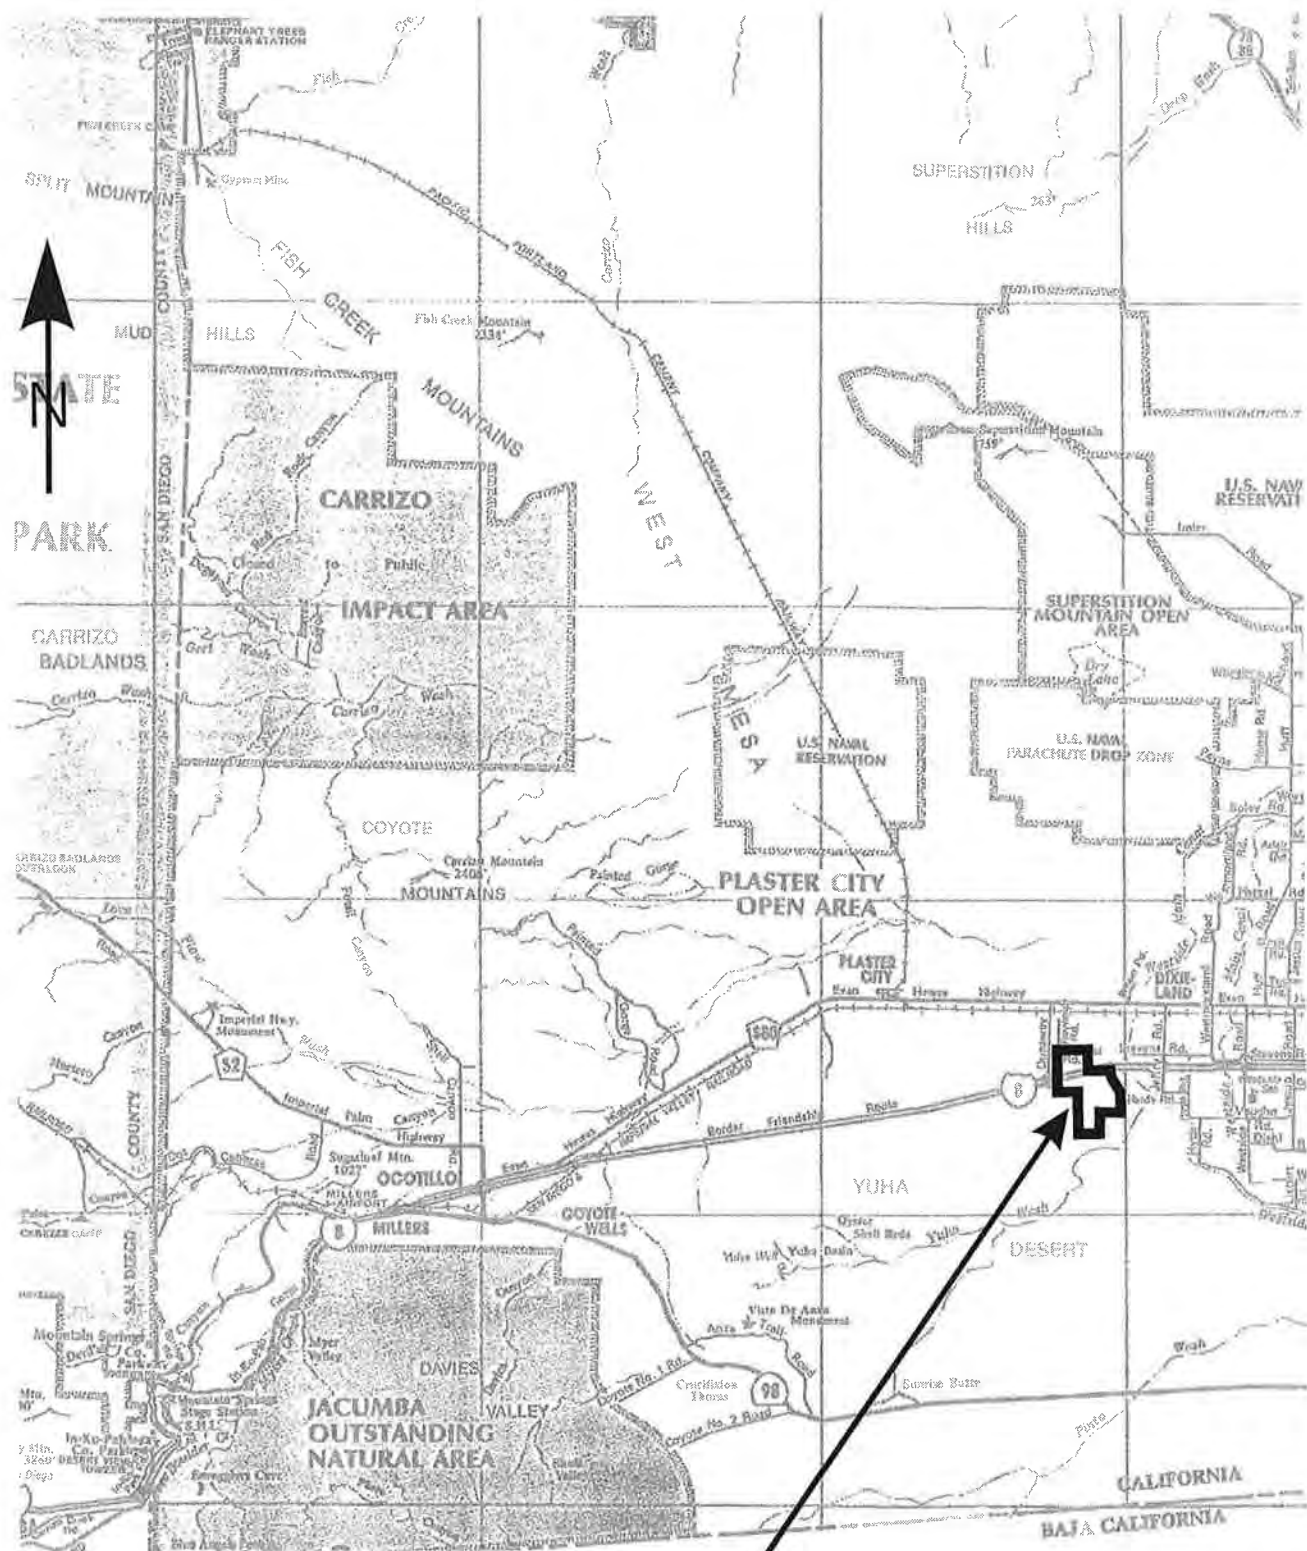
We recommend that a qualified geotechnical consultant be retained to provide the tests and observations services during construction. *The geotechnical engineering firm providing such tests and observations shall become the geotechnical engineer of record and assume responsibility for the project.*

The professional opinions presented in this report are based on the assumption that:

- ▶ Consultation during development of design and construction documents to check that the geotechnical professional opinions are appropriate for the proposed project and that the geotechnical professional opinions are properly interpreted and incorporated into the documents.
- ▶ Landmark Consultants will have the opportunity to review and comment on the plans and specifications for the project prior to the issuance of such for bidding.
- ▶ Observation, inspection, and testing by the geotechnical consultant of record during site clearing, grading, excavation, placement of fills, building pad and subgrade preparation, and backfilling of utility trenches.
- ▶ Observation of foundation excavations and reinforcing steel before concrete placement.
- ▶ Other consultation as necessary during design and construction.

We emphasize our review of the project plans and specifications to check for compatibility with our professional opinions and conclusions. Additional information concerning the scope and cost of these services can be obtained from our office.

# APPENDIX A



Project Site


**LANDMARK**

Geo-Engineers and Geologists

Project No.: LE10093

Vicinity Map

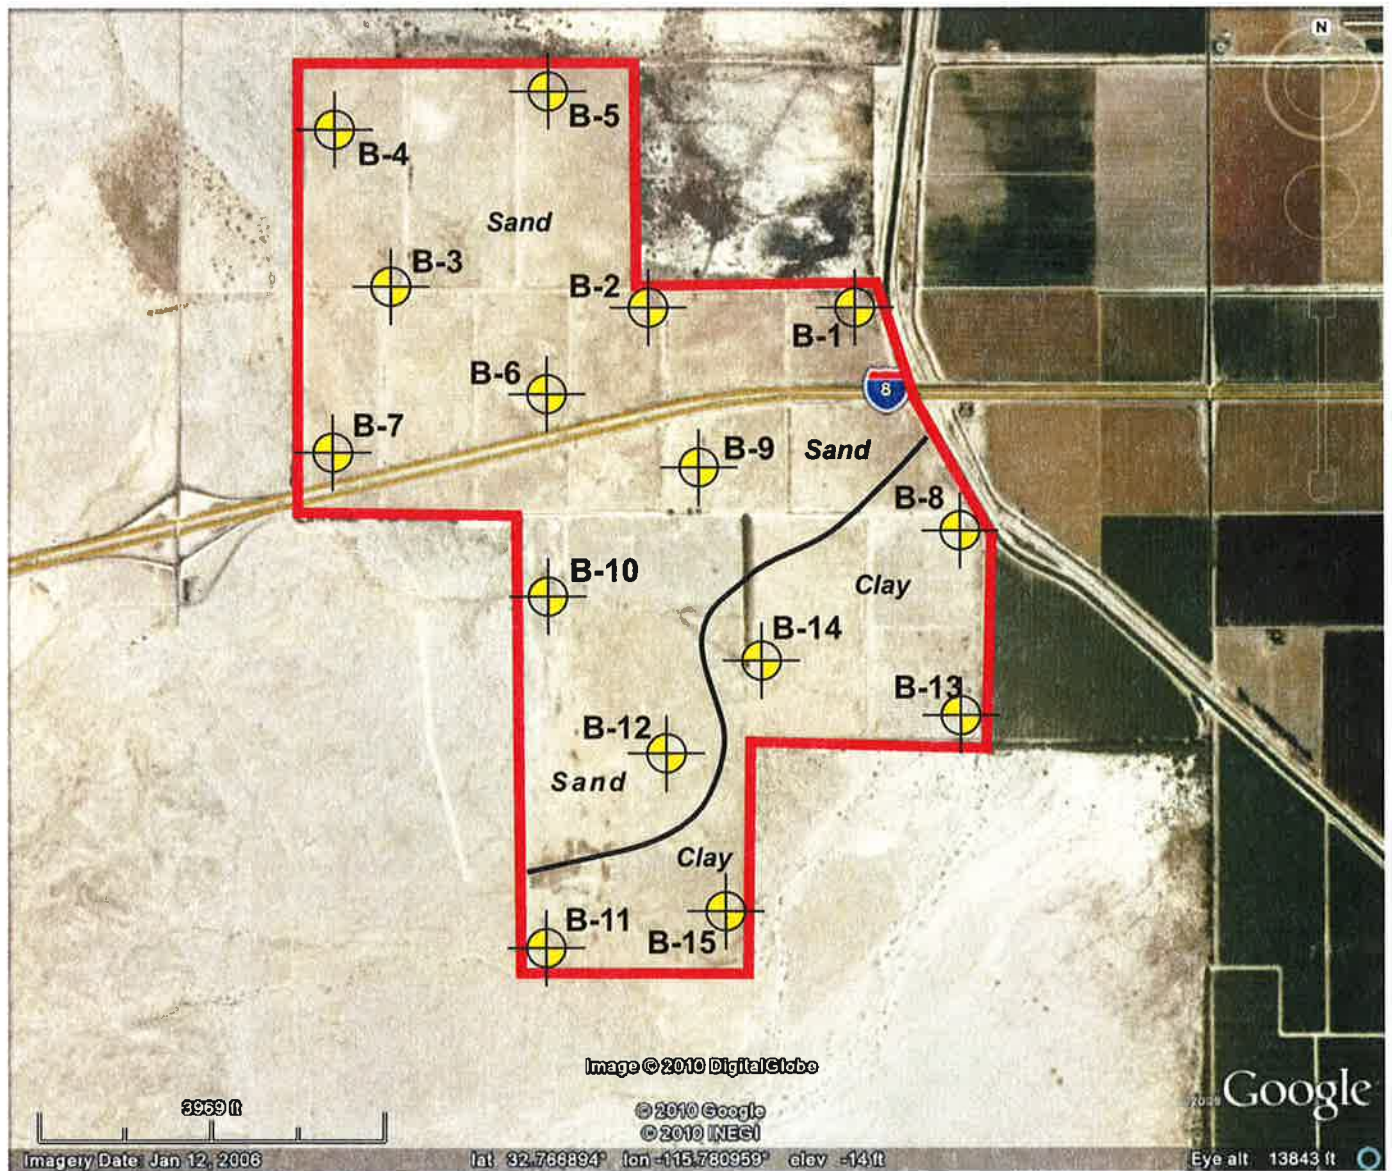Plate  
A-1



**LANDMARK**


Geo-Engineers and Geologists

Project No.: LE10093

Boring Location Map

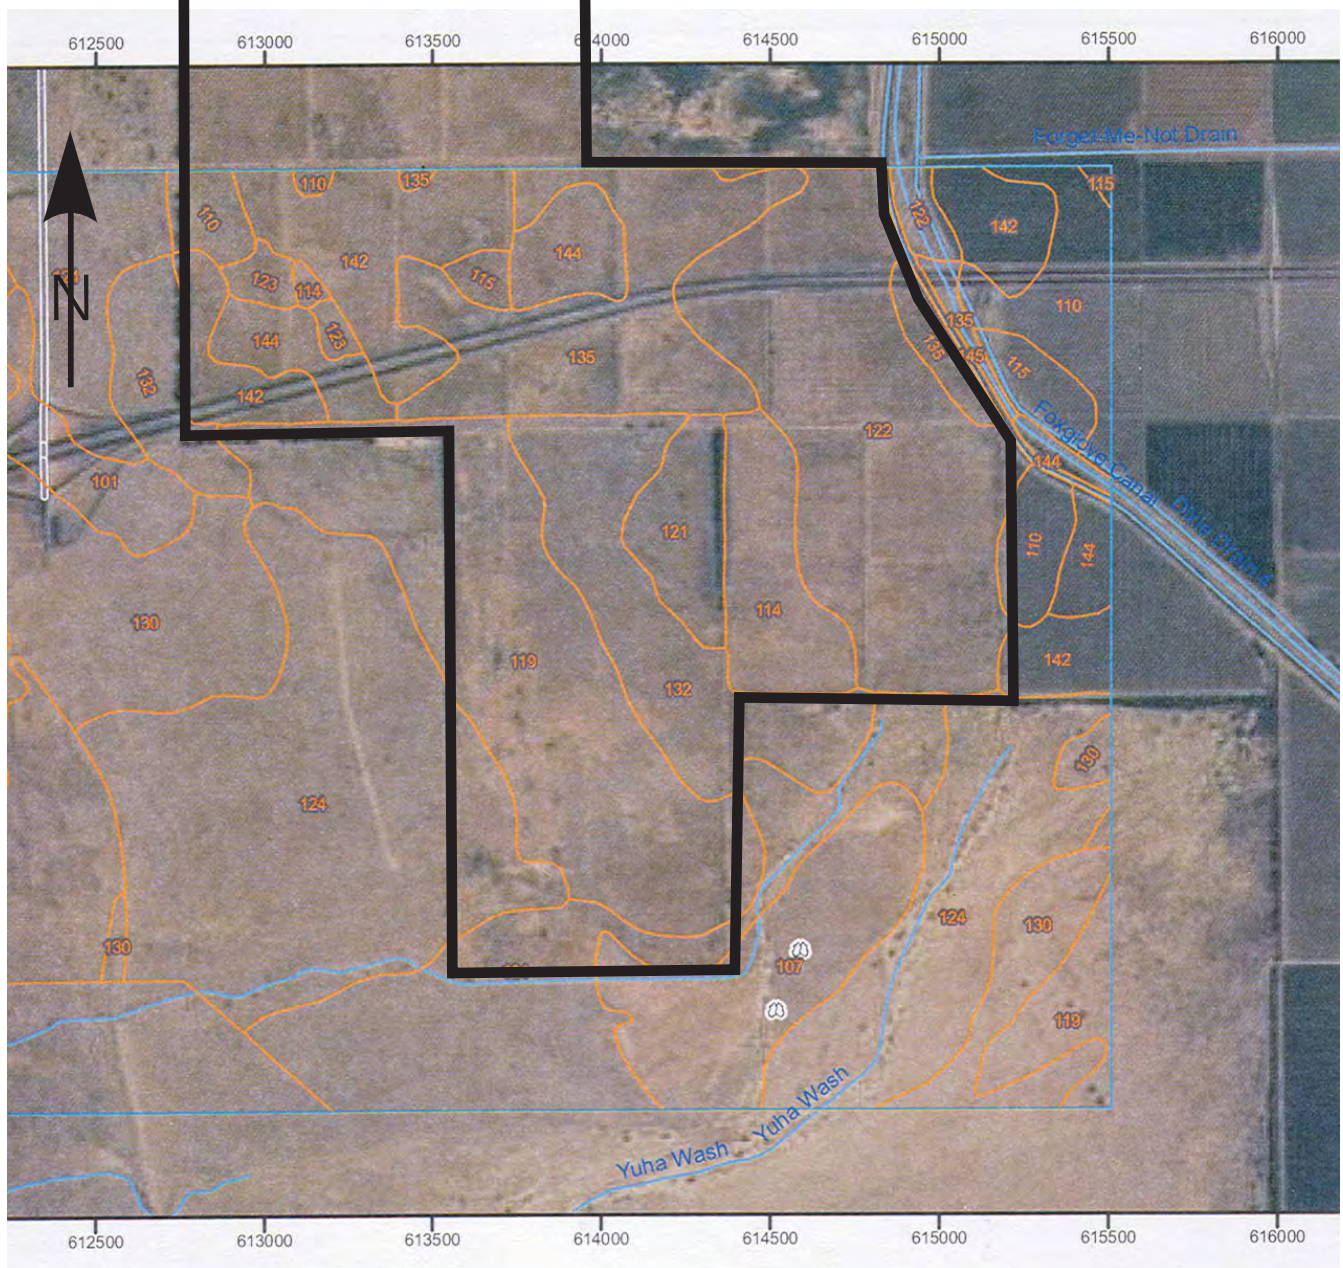Plate  
A-2





**LANDMARK**  
Geo-Engineers and Geologists


Project No.: LE10093

Soil Survey Map

Plate  
A-3

Soil Survey of

# **IMPERIAL COUNTY CALIFORNIA IMPERIAL VALLEY AREA**

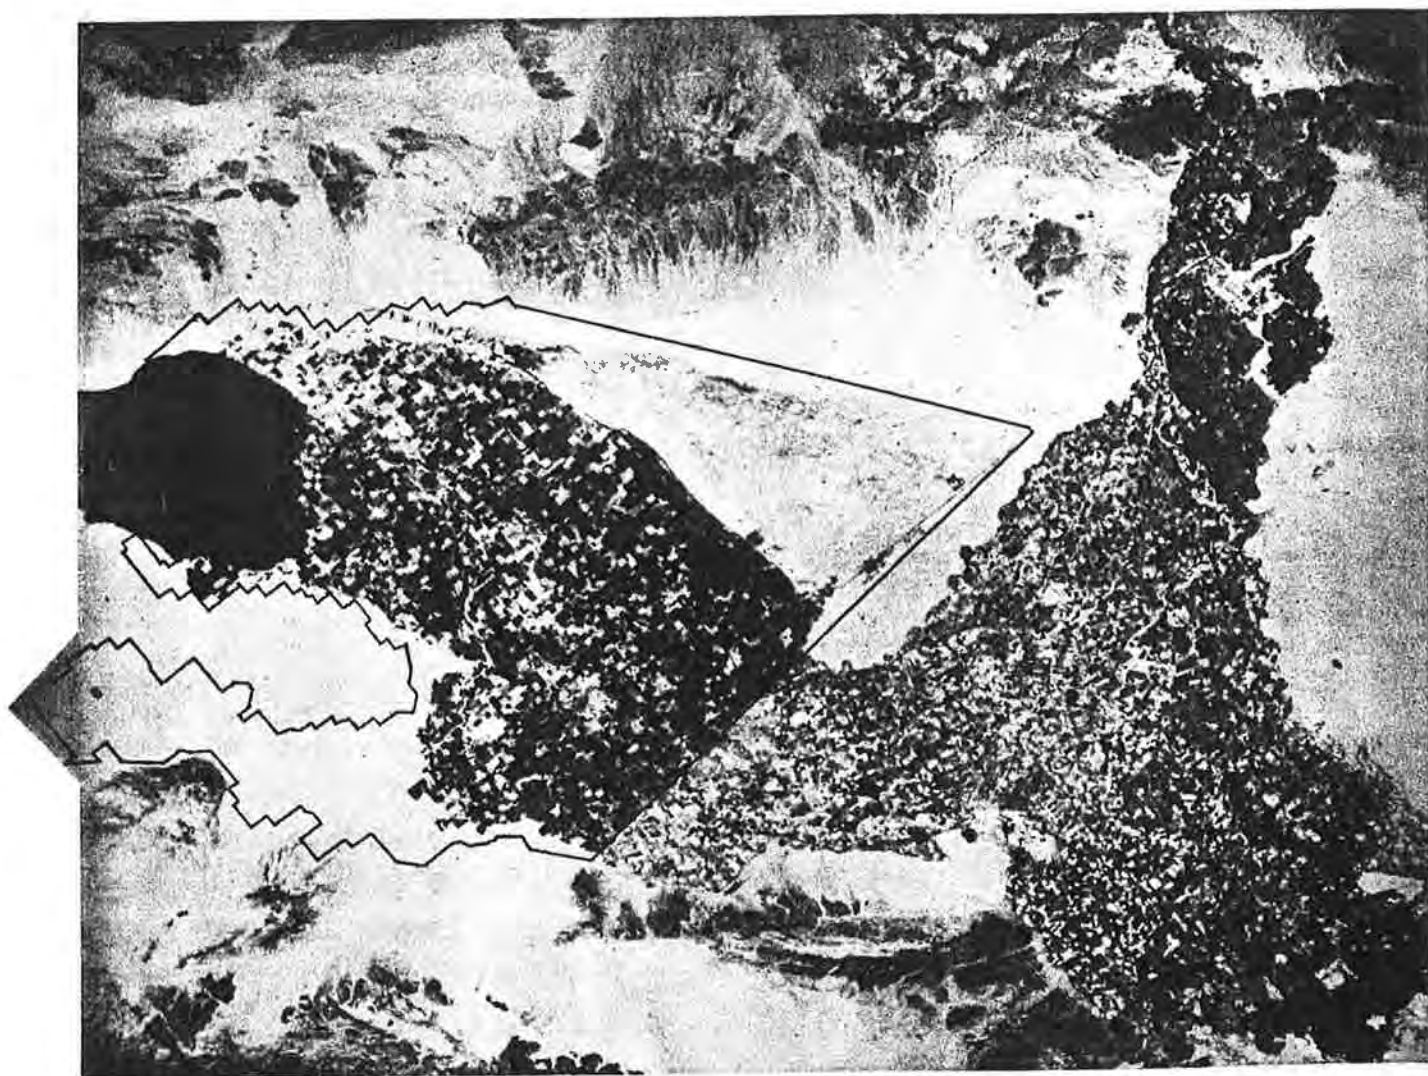

**United States Department of Agriculture Soil Conservation Service**  
in cooperation with  
**University of California Agricultural Experiment Station**  
and  
**Imperial Irrigation District**

TABLE 11.--ENGINEERING INDEX PROPERTIES

[The symbol &gt; means more than. Absence of an entry indicates that data were not estimated]

Soil name and map symbol	Depth	USDA texture	Classification		Frag-ments > 3 inches	Percentage passing sieve number--				Liquid limit	Plas-ticity index
			Unified	AASHTO		4	10	40	200		
	In				Pct					Pct	
100----- Antho	0-13 13-60	Loamy fine sand Sandy loam, fine sandy loam.	SM SM	A-2 A-2, A-4	0 0	100 90-100	100 75-95	75-85 50-60	10-30 15-40	--- ---	NP NP
101*: Antho-----	0-8 8-60	Loamy fine sand Sandy loam, fine sandy loam.	SM SM	A-2 A-2, A-4	0 0	100 90-100	100 75-95	75-85 50-60	10-30 15-40	--- ---	NP NP
Superstition-----	0-6 6-60	Fine sand----- Loamy fine sand, fine sand, sand.	SM SM	A-2 A-2	0 0	100 100	95-100 95-100	70-85 70-85	15-25 15-25	--- ---	NP NP
102*. Badland											
103----- Carsitas	0-10 10-60	Gravelly sand--- Gravelly sand, gravelly coarse sand, sand.	SP, SP-SM SP, SP-SM	A-1, A-2 A-1	0-5 0-5	60-90 60-90	50-85 50-85	30-55 25-50	0-10 0-10	--- ---	NP NP
104* Fluvaquents											
105----- Glenbar	0-13 13-60	Clay loam----- Clay loam, silty clay loam.	CL CL	A-6 A-6	0 0	100 100	100 100	90-100 90-100	70-95 70-95	35-45 35-45	15-30 15-30
106----- Glenbar	0-13 13-60	Clay loam----- Clay loam, silty clay loam.	CL CL	A-6, A-7 A-6, A-7	0 0	100 100	100 100	90-100 90-100	70-95 70-95	35-45 35-45	15-25 15-25
107*----- Glenbar	0-13 13-60	Loam----- Clay loam, silty clay loam.	ML, CL-ML, CL	A-4 A-6, A-7	0 0	100 100	100 100	100 95-100	70-80 75-95	20-30 35-45	NP-10 15-30
108----- Holtville	0-14 14-22 22-60	Loam----- Clay, silty clay Silt loam, very fine sandy loam.	ML CL, CH ML	A-4 A-7 A-4	0 0 0	100 100 100	100 100 100	85-100 95-100 95-100	55-95 85-95 65-85	25-35 40-65 25-35	NP-10 20-35 NP-10
109----- Holtville	0-17 17-24 24-35 35-60	Silty clay----- Clay, silty clay Silt loam, very fine sandy loam. Loamy very fine sand, loamy fine sand.	CL, CH CL, CH ML SM, ML	A-7 A-7 A-4 A-2, A-4	0 0 0 0	100 100 100 100	100 100 100 100	95-100 95-100 95-100 75-100	85-95 85-95 65-85 20-55	40-65 40-65 25-35 ---	20-35 20-35 NP-10 NP
110----- Holtville	0-17 17-24 24-35 35-60	Silty clay----- Clay, silty clay Silt loam, very fine sandy loam. Loamy very fine sand, loamy fine sand.	CH, CL CH, CL ML SM, ML	A-7 A-7 A-4 A-2, A-4	0 0 0 0	100 100 100 100	100 100 100 100	95-100 95-100 95-100 75-100	85-95 85-95 55-85 20-55	40-65 40-65 25-35 ---	20-35 20-35 NP-10 NP

See footnote at end of table.



TABLE 11.--ENGINEERING INDEX PROPERTIES--Continued

Soil name and map symbol	Depth	USDA texture	Classification		Frag- ments > 3 inches Pct	Percentage passing sieve number--				Liquid limit Pct	Plas- ticity index
			Unified	AASHTO		4	10	40	200		
111*: Holtville-----	0-10	Silty clay loam	CL, CH	A-7	0	100	100	95-100	85-95	40-65	20-35
	10-22	Clay, silty clay	CL, CH	A-7	0	100	100	95-100	85-95	40-65	20-35
	22-60	Silt loam, very fine sandy loam.	ML	A-4	0	100	100	95-100	65-85	25-35	NP-10
Imperial-----	0-12	Silty clay loam	CL	A-7	0	100	100	100	85-95	40-50	10-20
	12-60	Silty clay loam, silty clay, clay.	CH	A-7	0	100	100	100	85-95	50-70	25-45
112-----	0-12	Silty clay-----	CH	A-7	0	100	100	100	85-95	50-70	25-45
Imperial	12-60	Silty clay loam, silty clay, clay.	CH	A-7	0	100	100	100	85-95	50-70	25-45
113-----	0-12	Silty clay-----	CH	A-7	0	100	100	100	85-95	50-70	25-45
Imperial	12-60	Silty clay, clay, silty clay loam.	CH	A-7	0	100	100	100	85-95	50-70	25-45
114-----	0-12	Silty clay-----	CH	A-7	0	100	100	100	85-95	50-70	25-45
Imperial	12-60	Silty clay loam, silty clay, clay.	CH	A-7	0	100	100	100	85-95	50-70	25-45
115*: Imperial-----	0-12	Silty clay loam	CL	A-7	0	100	100	100	85-95	40-50	10-20
	12-60	Silty clay loam, silty clay, clay.	CH	A-7	0	100	100	100	85-95	50-70	25-45
Glenbar-----	0-13	Silty clay loam	CL	A-6, A-7	0	100	100	90-100	70-95	35-45	15-25
	13-60	Clay loam, silty clay loam.	CL	A-6, A-7	0	100	100	90-100	70-95	35-45	15-25
116*: Imperial-----	0-13	Silty clay loam	CL	A-7	0	100	100	100	85-95	40-50	10-20
	13-60	Silty clay loam, silty clay, clay.	CH	A-7	0	100	100	100	85-95	50-70	25-45
Glenbar-----	0-13	Silty clay loam	CL	A-6, A-7	0	100	100	90-100	70-95	35-45	15-25
	13-60	Clay loam, silty clay loam.	CL	A-6	0	100	100	90-100	70-95	35-45	15-30
117, 118----- Indio	0-12	Loam-----	ML	A-4	0	95-100	95-100	85-100	75-90	20-30	NP-5
	12-72	Stratified loamy very fine sand to silt loam.	ML	A-4	0	95-100	95-100	85-100	75-90	20-30	NP-5
119*: Indio-----	0-12	Loam-----	ML	A-4	0	95-100	95-100	85-100	75-90	20-30	NP-5
	12-72	Stratified loamy very fine sand to silt loam.	ML	A-4	0	95-100	95-100	85-100	75-90	20-30	NP-5
Vint-----	0-10	Loamy fine sand	SM	A-2	0	95-100	95-100	70-80	25-35	---	NP
	10-60	Loamy sand, loamy fine sand.	SM	A-2	0	95-100	95-100	70-80	20-30	---	NP
120*----- Laveen	0-12	Loam-----	ML, CL-ML	A-4	0	100	95-100	75-85	55-65	20-30	NP-10
	12-60	Loam, very fine sandy loam.	ML, CL-ML	A-4	0	95-100	85-95	70-80	55-65	15-25	NP-10

See footnote at end of table.



TABLE 11.--ENGINEERING INDEX PROPERTIES--Continued


Soil name and map symbol	Depth	USDA texture	Classification		Frag- ments > 3 inches	Percentage passing sieve number--				Liquid limit Pct	Plas- ticity index
			Unified	AASHTO		4	10	40	200		
	<u>In</u>				<u>Pct</u>						
121----- Meloland	0-12	Fine sand-----	SM, SP-SM	A-2, A-3	0	95-100	90-100	75-100	5-30	---	NP
	12-26	Stratified loamy fine sand to silt loam.	ML	A-4	0	100	100	90-100	50-65	25-35	NP-10
	26-71	Clay, silty clay, silty clay loam.	CL, CH	A-7	0	100	100	95-100	85-95	40-65	20-40
122----- Meloland	0-12	Very fine sandy loam.	ML	A-4	0	95-100	95-100	95-100	55-85	25-35	NP-10
	12-26	Stratified loamy fine sand to silt loam.	ML	A-4	0	100	100	90-100	50-70	25-35	NP-10
	26-71	Clay, silty clay, silty clay loam.	CH, CL	A-7	0	100	100	95-100	85-95	40-65	20-40
123*: Meloland-----	0-12	Loam-----	ML	A-4	0	95-100	95-100	95-100	55-85	25-35	NP-10
	12-26	Stratified loamy fine sand to silt loam.	ML	A-4	0	100	100	90-100	50-70	25-35	NP-10
	26-38	Clay, silty clay, silty clay loam.	CH, CL	A-7	0	100	100	95-100	85-95	40-65	20-40
	38-60	Stratified silt loam to loamy fine sand.	SM, ML	A-4	0	100	100	75-100	35-55	25-35	NP-10
Holtville-----	0-12	Loam-----	ML	A-4	0	100	100	85-100	55-95	25-35	NP-10
	12-24	Clay, silty clay	CH, CL	A-7	0	100	100	95-100	85-95	40-65	20-35
	24-36	Silt loam, very fine sandy loam.	ML	A-4	0	100	100	95-100	55-85	25-35	NP-10
	36-60	Loamy very fine sand, loamy fine sand.	SM, ML	A-2, A-4	0	100	100	75-100	20-55	---	NP
124, 125----- Niland	0-23	Gravelly sand---	SM, SP-SM	A-2, A-3	0	90-100	70-95	50-65	5-25	---	NP
	23-60	Silty clay, clay, clay loam.	CL, CH	A-7	0	100	100	85-100	80-95	40-65	20-40
126----- Niland	0-23	Fine sand-----	SM, SP-SM	A-2, A-3	0	90-100	90-100	50-65	5-25	---	NP
	23-60	Silty clay-----	CL, CH	A-7	0	100	100	85-100	80-95	40-65	20-40
127----- Niland	0-23	Loamy fine sand	SM	A-2	0	90-100	90-100	50-65	15-30	---	NP
	23-60	Silty clay-----	CL, CH	A-7	0	100	100	85-100	80-95	40-65	20-40
128*: Niland-----	0-23	Gravelly sand---	SM, SP-SM	A-2, A-3	0	90-100	70-95	50-65	5-25	---	NP
	23-60	Silty clay, clay, clay loam.	CL, CH	A-7	0	100	100	85-100	80-100	40-65	20-40
Imperial-----	0-12	Silty clay-----	CH	A-7	0	100	100	100	85-95	50-70	25-45
	12-60	Silty clay loam, silty clay, clay.	CH	A-7	0	100	100	100	85-95	50-70	25-45
129*: Pits											
130, 131----- Rositas	0-27	Sand-----	SP-SM	A-3, A-1, A-2	0	100	80-100	40-70	5-15	---	NP
	27-60	Sand, fine sand, loamy sand.	SM, SP-SM	A-3, A-2, A-1	0	100	80-100	40-85	5-30	---	NP

See footnote at end of table.

TABLE 11.--ENGINEERING INDEX PROPERTIES--Continued

Soil name and map symbol	Depth	USDA texture	Classification		Frag- ments > 3 inches Pet	Percentage passing sieve number--				Liquid limit Pet	Plas- ticity index
			Unified	AASHTO		4	10	40	200		
132, 133, 134, 135- Rositas	0-9	Fine sand-----	SM	A-3, A-2	0	100	80-100	50-80	10-25	---	NP
	9-60	Sand, fine sand, loamy sand.	SM, SP-SM	A-3, A-2, A-1	0	100	80-100	40-85	5-30	---	NP
136----- Rositas	0-4	Loamy fine sand	SM	A-1, A-2	0	100	80-100	40-85	10-35	---	NP
	4-60	Sand, fine sand, loamy sand.	SM, SP-SM	A-3, A-2, A-1	0	100	80-100	40-85	5-30	---	NP
137----- Rositas	0-12	Silt loam-----	ML	A-4	0	100	100	90-100	70-90	20-30	NP-5
	12-60	Sand, fine sand, loamy sand.	SM, SP-SM	A-3, A-2, A-1	0	100	80-100	40-85	5-30	---	NP
138*: Rositas-----	0-4	Loamy fine sand	SM	A-1, A-2	0	100	80-100	40-85	10-35	---	NP
	4-60	Sand, fine sand, loamy sand.	SM, SP-SM	A-3, A-2, A-1	0	100	80-100	40-85	5-30	---	NP
Superstition-----	0-6	Loamy fine sand	SM	A-2	0	100	95-100	70-85	15-25	---	NP
	6-60	Loamy fine sand, fine sand, sand.	SM	A-2	0	100	95-100	70-85	15-25	---	NP
139----- Superstition	0-6	Loamy fine sand	SM	A-2	0	100	95-100	70-85	15-25	---	NP
	6-60	Loamy fine sand, fine sand, sand.	SM	A-2	0	100	95-100	70-85	15-25	---	NP
140*: Torriorthents											
Rock outcrop											
141*: Torriorthents											
Orthids											
142----- Vint	0-10	Loamy very fine sand.	SM, ML	A-4	0	100	100	85-95	40-65	15-25	NP-5
	10-60	Loamy fine sand	SM	A-2	0	95-100	95-100	70-80	20-30	---	NP
143----- Vint	0-12	Fine sandy loam	ML, CL-ML, SM, SM-SC	A-4	0	100	100	75-85	45-55	15-25	NP-5
	12-60	Loamy sand, loamy fine sand.	SM	A-2	0	95-100	95-100	70-80	20-30	---	NP
144*: Vint-----	0-10	Very fine sandy loam.	SM, ML	A-4	0	100	100	85-95	40-65	15-25	NP-5
	10-40	Loamy fine sand	SM	A-2	0	95-100	95-100	70-80	20-30	---	NP
	40-60	Silty clay-----	CL, CH	A-7	0	100	100	95-100	85-95	40-65	20-35
Indio-----	0-12	Very fine sandy loam.	ML	A-4	0	95-100	95-100	85-100	75-90	20-30	NP-5
	12-40	Stratified loamy very fine sand to silt loam.	ML	A-4	0	95-100	95-100	85-100	75-90	20-30	NP-5
	40-72	Silty clay-----	CL, CH	A-7	0	100	100	95-100	85-95	40-65	20-35

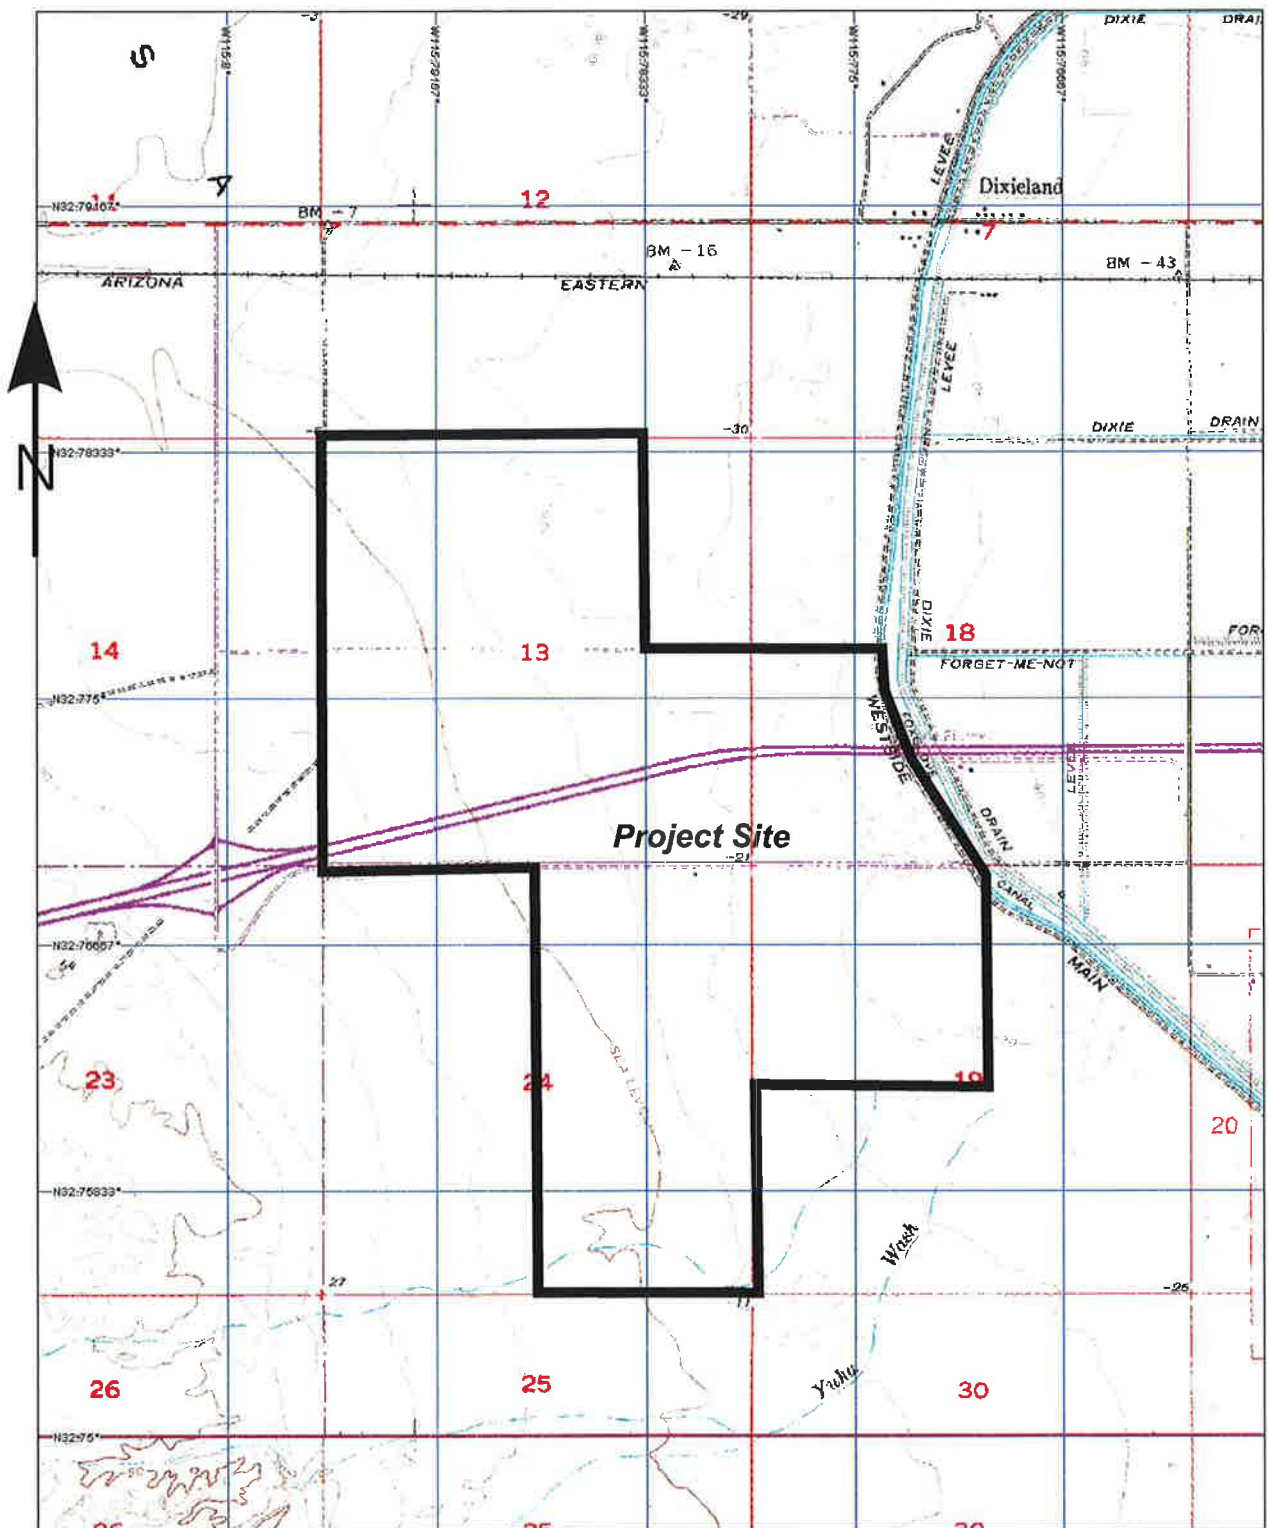\* See description of the map unit for composition and behavior characteristics of the map unit.



3-D TopoQuads Copyright © 1999 DeLorme Yarmouth, ME 04096 Source Data: USGS 700 ft Scale: 1:24,000 Detail: 13-1 Datum: WGS84








**LANDMARK**  
Geo-Engineers and Geologists

Project No.: LE10093


Topographic Map

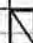Plate  
A-4

## **APPENDIX B**

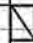DEPTH	FIELD				LOG OF BORING No. 1 SHEET 1 OF 1	LABORATORY		
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)	DESCRIPTION OF MATERIAL	DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)	OTHER TESTS
5					SILTY SAND (SM): Orange brown, dry, fine grained sand, some silt.	106.2	20.8	
			17	4.0	CLAY/SILTY SAND (CH/SM): Reddish brown/Lt. brown, moist, hard/medium dense, interbedded.			
10			51		SILTY SAND (SM): Lt. brown, moist, very dense to medium dense, fine grained sand. <div style="text-align: right;">Anticipated GW=13.0 ft </div>			
15			21		saturated, green/gray clay at tip of sampler.			
20			30		some green/gray clay interbeds.			
25					Total Depth = 21.5' Groundwater was encountered at 15.0 ft at the time of exploration but may raise with time to about 13.0 ft bgs. Backfilled with excavated soil			
30								
35								
40								
45								
50								
55								
60								

DATE DRILLED: 04/28/10	TOTAL DEPTH: 21.5 Feet	DEPTH TO WATER: +/- 13.0 ft.
LOGGED BY: J. Avalos	TYPE OF BIT: Hollow Stem Auger	DIAMETER: 8 in.
SURFACE ELEVATION: -30 ft	HAMMER WT.: 140 lbs.	DROP: 30 in.

PROJECT No. LE10093	 <b>LANDMARK</b> Geo-Engineers and Geologists	PLATE B-1
---------------------	---	-----------


DEPTH	FIELD				LOG OF BORING No. 2 SHEET 1 OF 1	LABORATORY		
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)		DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)	OTHER TESTS
					DESCRIPTION OF MATERIAL			
	●				SILTY SAND (SM): Orange brown, dry, fine grained sand, some silt.			
5	▧		15		SANDY SILTY (ML): Lt. brown, moist, medium dense, some fine sand.			
10	▧		57		SILTY SAND (SM): Lt. brown, moist, very dense to medium dense, fine grained sand.	102.6	4.5	SAND=82% FINES=18%
15	▧		53		SANDY SILTY (ML): Lt. brown, moist, very dense, some fine sand.			
20	▧		50/3.5"		some green/gray clay interbeds.			
25					Total Depth = 21.5' Groundwater was not encountered at the time of exploration Backfilled with excavated soil			
30								
35								
40								
45								
50								
55								
60								







DATE DRILLED:	04/28/10	TOTAL DEPTH:	21.5 Feet	DEPTH TO WATER:	NA
LOGGED BY:	J. Avalos	TYPE OF BIT:	Hollow Stem Auger	DIAMETER:	8 in.
SURFACE ELEVATION:	-17 ft	HAMMER WT.:	140 lbs.	DROP:	30 in.

PROJECT No. LE10093

**LANDMARK**  
Geo-Engineers and Geologists

PLATE B-2

DEPTH	FIELD				LOG OF BORING No. 3 SHEET 1 OF 1	LABORATORY		
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)		DESCRIPTION OF MATERIAL	DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)
5	●		39		SILTY SAND (SM): Lt. brown, dry to moist, fine grained, medium dense to very dense.	105.4	2.4	SAND=96% FINES=4%
10	▲		26					
15	▲		50/3.5"					
20	▲		28					
25					Total Depth = 21.5' Groundwater was not encountered at the time of exploration Backfilled with excavated soil			
30								
35								
40								
45								
50								
55								
60								
DATE DRILLED: 04/28/10      TOTAL DEPTH: 21.5 Feet      DEPTH TO WATER: NA LOGGED BY: J. Avalos      TYPE OF BIT: Hollow Stem Auger      DIAMETER: 8 in. SURFACE ELEVATION: +1 ft      HAMMER WT.: 140 lbs.      DROP: 30 in.								
PROJECT No. LE10093							PLATE B-3	

DEPTH	FIELD				LOG OF BORING No. 4 SHEET 1 OF 1	LABORATORY			
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)		DESCRIPTION OF MATERIAL	DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)	OTHER TESTS
5			39		<p>SAND (SP-SM): Lt. brown, dry to humid, fine grained, dense to very dense.</p> <p>some sandy silt.</p>	103.5	1.0	SAND=91% FINES=9%	
10			53						
15			50/4"						
20			57						
25					<p>Total Depth = 21.5'</p> <p>Groundwater was not encountered at the time of exploration</p> <p>Backfilled with excavated soil</p>				
30									
35									
40									
45									
50									
55									
60									
DATE DRILLED: 04/28/10      TOTAL DEPTH: 21.5 Feet      DEPTH TO WATER: NA LOGGED BY: J. Avalos      TYPE OF BIT: Hollow Stem Auger      DIAMETER: 8 in. SURFACE ELEVATION: -1 ft      HAMMER WT.: 140 lbs.      DROP: 30 in.									
PROJECT No. LE10093							PLATE B-4		







DEPTH	FIELD				LOG OF BORING No. 5 SHEET 1 OF 1	LABORATORY		
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)		DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)	OTHER TESTS
					SILTY SAND (SM): Dark brown, moist, fine to medium grained, some fine gravel.			
5			39	4.5	CLAY/SILTY SAND (CH/SM): Reddish brown/Lt. brown, moist, hard/medium dense, fine to medium grained, interbedded.	117.6	9.0	
10			50/4.5"	4.5	CLAY (CH): Reddish brown, moist, hard, high plasticity			
15			31		SAND (SP): Lt. brown, moist, dense, fine to coarse grained.			
20			76		Anticipated GW=18.0 ft saturated, very dense, some fine gravel.	120.7	11.3	SAND=98% FINES=2%
25			22	4.5	CLAY (CH): Reddish brown, very moist, hard, high plasticity			
30			13		SILTY SAND (SM): Lt. brown, saturated, medium dense, fine to coarse grained.			SAND=90% FINES=10%
35			60		saturated, very dense, some fine gravel.			
40			11	4.0	CLAYEY SAND (SC): Brown, saturated, medium dense, medium plasticity, fine grained sand.			
45			8	+4.5	CLAY (CH): Reddish brown, very moist, hard, high plasticity.			
50			23	+4.5	SILTY SAND (SM): Grey brown, saturated, medium dense, fine grained sand CLAY (CH): Reddish brown, very moist, hard, high plasticity.			
55					Total Depth = 51.5' Groundwater was encountered at 20.0 ft at the time of exploration but may raise with time to about 18.0 ft bgs. Backfilled with excavated soil			
60								

DATE DRILLED: 04/28/10	TOTAL DEPTH: 51.5 Feet	DEPTH TO WATER: +/- 18.0 ft.
LOGGED BY: J. Avalos	TYPE OF BIT: Hollow Stem Auger	DIAMETER: 8 in.
SURFACE ELEVATION: -18 ft	HAMMER WT.: 140 lbs.	DROP: 30 in.

PROJECT No. LE10093

**LANDMARK**  
Geo-Engineers and Geologists

PLATE B-5





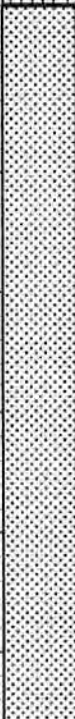



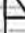

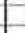
DEPTH	FIELD				LOG OF BORING No. 6 SHEET 1 OF 1	LABORATORY		
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)		DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)	OTHER TESTS
5			28		SANDY SILT (ML): Lt. brown, dry, medium dense, some fine sand, thin interbedded clay layer.	105.7	4.1	SAND=81% FINES=19%
10			50/2.5"		SILTY SAND (SM): Lt. brown, dry to humid, very dense, fine grained sand, some sandy silt.			
15			79					
20			54		CLAYEY SILT/SILT (ML): Lt. brown, moist, very dense, low plasticity.			
25					Total Depth = 21.5'			
30					Groundwater was not encountered at the time of exploration			
35					Backfilled with excavated soil			
40								
45								
50								
55								
60								

DATE DRILLED:	04/28/10	TOTAL DEPTH:	21.5 Feet	DEPTH TO WATER:	NA
LOGGED BY:	J. Avalos	TYPE OF BIT:	Hollow Stem Auger	DIAMETER:	8 in.
SURFACE ELEVATION:	-6 ft	HAMMER WT.:	140 lbs.	DROP:	30 in.

PROJECT No. LE10093

**LANDMARK**  
Geo-Engineers and Geologists

PLATE B-6




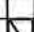

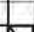







DEPTH	FIELD				LOG OF BORING No. 7 SHEET 1 OF 1	LABORATORY		
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)		DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)	OTHER TESTS
5			16		SANDY SILT (ML): Brown, moist, medium dense to very dense, fine grained sand.	109.2	7.6	SAND=47% FINES=53%
10			50/5.5"					
15			76					
20			37		SAND (SP-SM): Lt. brown, humid to moist, dense to very dense, very fine to fine grained.	104.7	3.2	SAND=91% FINES=9%
25			38					
30			49					
35			50/4"					
40			50/4"					
45			50/5"					
50			50/5"		SANDY SILT (ML): Brown, saturated, very dense, fine grained sand.			
55					Total Depth = 51.5' Groundwater was encountered at 49.0 ft at the time of exploration Backfilled with excavated soil			
60								

DATE DRILLED: 04/28/10 TOTAL DEPTH: 51.5 Feet DEPTH TO WATER: +/- 49.0 ft.  
 LOGGED BY: J. Avalos TYPE OF BIT: Hollow Stem Auger DIAMETER: 8 in.  
 SURFACE ELEVATION: +13 ft HAMMER WT.: 140 lbs. DROP: 30 in.

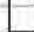PROJECT No. LE10093

**LANDMARK**  
Geo-Engineers and Geologists

PLATE B-7








DEPTH	FIELD				LOG OF BORING No. 8 SHEET 1 OF 1	LABORATORY		
	SAMPLE	USCS CLASS	BLOW COUNT	POCKET PEN. (tsf)		DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)	OTHER TESTS
5			18	4.0	SILTY CLAY (CL): Light brown, dry, medium plasticity	108.6	20.8	LL=28 PI=14%  C = 1.74 tsf
10			35	4.0	CLAY (CH): Reddish brown, very moist, very stiff to hard, high plasticity			
15			17	4.0				
20			25	4.0				
25			30	4.5				
30			50/6"		SAND (SW): Gray brown, saturated, very dense, fine to coarse grained sand, with some gravel of 3/8" max size			
35			53					
40		50/5"			SILTY SAND (SM): Brown, moist, saturated, fine grained sand			
45			29	+4.5	CLAY (CH): Reddish brown, very moist, hard, high plasticity, with thin interbedded silty sand layer			
50			65		SILTY SAND (SM): Brown, saturated, very dense, fine grained sand			
55					Total Depth = 51.5' Groundwater was encountered at 18.0 ft at the time of exploration but may raise with time to about 8.0 ft bgs. Backfilled with excavated soil			
60								








DATE DRILLED: 04/28/10	TOTAL DEPTH: 51.5 Feet	DEPTH TO WATER: +/- 8.0 ft.
LOGGED BY: J. Avalos	TYPE OF BIT: Hollow Stem Auger	DIAMETER: 8 in.
SURFACE ELEVATION: -30 ft	HAMMER WT.: 140 lbs.	DROP: 30 in.

PROJECT No. LE10093

**LANDMARK**  
Geo-Engineers and Geologists

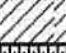PLATE B-8

DEPTH	FIELD				LOG OF BORING No. 9 SHEET 1 OF 1	LABORATORY			
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)	DESCRIPTION OF MATERIAL	DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)	OTHER TESTS	
					SILTY CLAY (CL): Lt. brown, dry, hard, low plasticity.				
5			47		SILTY SAND/SANDY SILT (SM/ML): Lt. brown, dry, dense, fine sand.				
10			37	4.5+	CLAY (CH): Reddish brown, moist, hard, high plasticity.	103.2	22.8	c = 2.45 tsf  LL=57 PI=39%	
15			15	4.5+					
20			17	4.5+					
25					Total Depth = 21.5' Groundwater was not encountered at the time of exploration Backfilled with excavated soil				
30									
35									
40									
45									
50									
55									
60									
DATE DRILLED: 04/28/10      TOTAL DEPTH: 21.5 Feet      DEPTH TO WATER: NA LOGGED BY: J. Avalos      TYPE OF BIT: Hollow Stem Auger      DIAMETER: 8 in. SURFACE ELEVATION: -13 ft      HAMMER WT.: 140 lbs.      DROP: 30 in.									
PROJECT No. LE10093							PLATE B-9		

DEPTH	FIELD				LOG OF BORING No. 10 SHEET 1 OF 1	LABORATORY		
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)		DESCRIPTION OF MATERIAL	DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)
5			59		SILTY SAND/SANDY SILT (SM/ML): Lt. brown, dry, dense, fine to coarse grained.	112.2	0.6	
10			28		some silt and fine gravel.			
15				4.5+	CLAY (CH): Reddish brown, moist, hard, high plasticity.			
20			50/4.5"		SILTY SAND (SM): Lt. brown, moist, dense, fine to coarse grained.			
			31					
25					Total Depth = 21.5' Groundwater was not encountered at the time of exploration Backfilled with excavated soil			
30								
35								
40								
45								
50								
55								
60								

DATE DRILLED:	04/28/10	TOTAL DEPTH:	21.5 Feet	DEPTH TO WATER:	NA
LOGGED BY:	J. Avalos	TYPE OF BIT:	Hollow Stem Auger	DIAMETER:	8 in.
SURFACE ELEVATION:	0 ft	HAMMER WT.:	140 lbs.	DROP:	30 in.

PROJECT No. LE10093	<b>LANDMARK</b> Geo-Engineers and Geologists	PLATE B-10
---------------------	---	------------

DEPTH	FIELD				LOG OF BORING No. 11 SHEET 1 OF 1	LABORATORY		
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)		DESCRIPTION OF MATERIAL	DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)
5	●				SILTY CLAY (CL): Lt. brown, dry, hard, medium plasticity.	108.3	18.5	LL=68% PI=46%  c = 3.31 tsf
10	▧		21	4.5+	CLAY (CH): Reddish brown, moist, hard, high plasticity.			
15	▧		75	4.5+				
20	▧		25	4.5+		106.7	3.2	
20	▧		50/5"		SILTY SAND (SM): Lt. gray-brown, dry, very dense, very fine grained.			
25					Total Depth = 21.5' Groundwater was not encountered at the time of exploration Backfilled with excavated soil			
30								
35								
40								
45								
50								
55								
60								

DATE DRILLED:	04/28/10	TOTAL DEPTH:	21.5 Feet	DEPTH TO WATER:	NA
LOGGED BY:	J. Avalos	TYPE OF BIT:	Hollow Stem Auger	DIAMETER:	8 in.
SURFACE ELEVATION:	+5 ft	HAMMER WT.:	140 lbs.	DROP:	30 in.

PROJECT No. LE10093	<b>LANDMARK</b> Geo-Engineers and Geologists	PLATE B-11
---------------------	---	------------

DEPTH	FIELD			LOG OF BORING No. 12 SHEET 1 OF 1	LABORATORY			
	SAMPLE	USCS CLASS.	BLOW COUNT		POCKET PEN. (tsf)	DESCRIPTION OF MATERIAL	DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)
5			13	4.5	SILTY SAND (SM): Lt. brown, dry, very fine grained.	101.8	2.7	LL=39% PI=22%  SAND=80% FINES=20%
10			64		SILTY CLAY (CL): Reddish brown, moist, hard, high plasticity.			
15			69		SILTY SAND (SM): Lt. brown, dry to humid, very dense to medium dense, very fine grained.			
20			27		medium dense, moist			
25					Total Depth = 21.5' Groundwater was not encountered at the time of exploration Backfilled with excavated soil			
30								
35								
40								
45								
50								
55								
60								

DATE DRILLED:	04/28/10	TOTAL DEPTH:	21.5 Feet	DEPTH TO WATER:	NA
LOGGED BY:	J. Avalos	TYPE OF BIT:	Hollow Stem Auger	DIAMETER:	8 in.
SURFACE ELEVATION:	0 ft	HAMMER WT.:	140 lbs.	DROP:	30 in.

PROJECT No. LE10093	<b>LANDMARK</b> Geo-Engineers and Geologists	PLATE B-12
---------------------	---	------------

















DEPTH	FIELD				LOG OF BORING No. 13 SHEET 1 OF 1	LABORATORY		
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)	DESCRIPTION OF MATERIAL	DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)	OTHER TESTS
5			74		SANDY SILT (ML): Tan, dry to damp, very fine grained sand.	97.8	5.2	SAND=2% FINES=98%
10			67	4.5+	CLAY (CH): Reddish brown, moist, hard, high plasticity, some sand stringers.	114.7	10.3	c = 3.61 tsf
15			11	3.5				
20			23	3.5	saturated sand at tip of sampler.			
25					Total Depth = 21.5' Groundwater was not encountered at the time of exploration Backfilled with excavated soil			
30								
35								
40								
45								
50								
55								
60								
DATE DRILLED: 04/29/10      TOTAL DEPTH: 21.5 Feet      DEPTH TO WATER: NA LOGGED BY: S. Williams      TYPE OF BIT: Hollow Stem Auger      DIAMETER: 8 in. SURFACE ELEVATION: 0 ft      HAMMER WT.: 140 lbs.      DROP: 30 in.								
PROJECT No. LE10093					 Geo-Engineers and Geologists		PLATE B-13	

DEPTH	FIELD				LOG OF BORING No. 14 SHEET 1 OF 1	LABORATORY		
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)	DESCRIPTION OF MATERIAL	DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)	OTHER TESTS
5			40	4.5+	SILTY CLAY (CL): Brown, dry to damp, hard.	105.9	22.1	LL=45% PI=30%
					SANDY SILT (ML): Tan, dry to damp, very fine grained sand.			
10			51	4.5	CLAY (CH): Brown, moist, hard, high plasticity, some sand stringers.			
15			13	4.5+	<p>Anticipated GW=18.0 ft</p>			
20			15		SILTY SAND (SM): Yellow, saturated, medium dense, fine to medium grained.			
25					<p>Total Depth = 21.5'</p> <p>Groundwater was encountered at 18 ft. at the time of exploration</p> <p>Backfilled with excavated soil</p>			
30								
35								
40								
45								
50								
55								
60								

DATE DRILLED: 04/29/10	TOTAL DEPTH: 21.5 Feet	DEPTH TO WATER: 18 ft.
LOGGED BY: S. Williams	TYPE OF BIT: Hollow Stem Auger	DIAMETER: 8 in.
SURFACE ELEVATION: 0 ft	HAMMER WT.: 140 lbs.	DROP: 30 in.

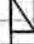PROJECT No. LE10093	 Geo-Engineers and Geologists	PLATE B-14
---------------------	----------------------------------	------------

DEPTH	FIELD				LOG OF BORING No. 15 SHEET 1 OF 1	LABORATORY		
	SAMPLE	USCS CLASS.	BLOW COUNT	POCKET PEN. (tsf)		DRY DENSITY (pcf)	MOISTURE CONTENT (% dry wt.)	OTHER TESTS
5			46		CLAY (CL-CH): Light brown, dry, medium to high plasticity  Reddish brown, moist, stiff to very stiff	118.7	15.8	
10			26					
15			48			98.0	10.5	C = 1.61 tsf
20			22					
25			50/5"		SAND (SP-SM): Light brown, moist to very moist, very dense, fine to medium grained sand  Anticipated GW=29.0 ft 	103.7	7.2	$\phi = 35^\circ$
30			30		Saturated			SAND=94.7% FINES=5.3%
35			50/5"					
40			50/1"		SILTY SAND (SM): Gray brown, saturated, dense to very dense, fine grained sand			SAND=76.9% FINES=23.1%
45			50/5"			101.8	21.9	$\phi = 39^\circ$
50			86					
55					Total Depth = 51.5' Groundwater was encountered at 31.9 ft at the time of exploration but may raise with time to about 29 ft bgs. Backfilled with excavated soil			
60								

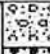










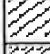

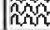
DATE DRILLED: 04/29/10 TOTAL DEPTH: 51.5 Feet DEPTH TO WATER: +/- 29 ft.  
 LOGGED BY: S. Williams TYPE OF BIT: Hollow Stem Auger DIAMETER: 8 in.  
 SURFACE ELEVATION: -5 ft HAMMER WT.: 140 lbs. DROP: 30 in.

PROJECT No. LE09220

**LANDMARK**  
Geo-Engineers and Geologists

PLATE B-15

## DEFINITION OF TERMS

PRIMARY DIVISIONS		SYMBOLS		SECONDARY DIVISIONS		
Coarse grained soils More than half of material is larger that No. 200 sieve	Gravels	Clean gravels (less than 5% fines)		GW	Well graded gravels, gravel-sand mixtures, little or no fines	
		More than half of coarse fraction is larger than No. 4 sieve	Gravel with fines		GP	Poorly graded gravels, or gravel-sand mixtures, little or no fines
					GM	Silty gravels, gravel-sand-silt mixtures, non-plastic fines
					GC	Clayey gravels, gravel-sand-clay mixtures, plastic fines
	Sands	Clean sands (less than 5% fines)		SW	Well graded sands, gravelly sands, little or no fines	
		More than half of coarse fraction is smaller than No. 4 sieve	Sands with fines		SP	Poorly graded sands or gravelly sands, little or no fines
					SM	Silly sands, sand-silt mixtures, non-plastic fines
					SC	Clayey sands, sand-clay mixtures, plastic fines
Fine grained soils More than half of material is smaller than No. 200 sieve	Silts and clays			ML	Inorganic silts, clayey silts with slight plasticity	
	Liquid limit is less than 50%			CL	Inorganic clays of low to medium plasticity, gravelly, sandy, or lean clays	
				OL	Organic silts and organic clays of low plasticity	
	Silts and clays			MH	Inorganic silts, micaceous or diatomaceous silty soils, elastic silts	
	Liquid limit is more than 50%			CH	Inorganic clays of high plasticity, fat clays	
				OH	Organic clays of medium to high plasticity, organic silts	
	Highly organic soils			PT	Peat and other highly organic soils	

### GRAIN SIZES

Silts and Clays	Sand			Gravel		Cobbles	Boulders
	Fine	Medium	Coarse	Fine	Coarse		
	200	40	10	4	3/4"	3"	12"
	US Standard Series Sieve				Clear Square Openings		

Sands, Gravels, etc.	Blows/ft. *
Very Loose	0-4
Loose	4-10
Medium Dense	10-30
Dense	30-50
Very Dense	Over 50

Clays & Plastic Silts	Strength **	Blows/ft. *
Very Soft	0-0.25	0-2
Soft	0.25-0.5	2-4
Firm	0.5-1.0	4-8
Stiff	1.0-2.0	8-16
Very Stiff	2.0-4.0	16-32
Hard	Over 4.0	Over 32


\* Number of blows of 140 lb. hammer falling 30 inches to drive a 2 inch O.D. (1 3/8 in. I.D.) split spoon (ASTM D1586).

\*\* Unconfined compressive strength in tons/s.f. as determined by laboratory testing or approximated by the Standard Penetration Test (ASTM D1586), Pocket Penetrometer, Torvane, or visual observation.

#### Type of Samples:

☒ Ring Sample
 ☒ Standard Penetration Test
 ☒ Shelby Tube
 ☒ Bulk (Bag) Sample

#### Drilling Notes:

- Sampling and Blow Counts
  - Ring Sampler - Number of blows per foot of a 140 lb. hammer falling 30 inches.
  - Standard Penetration Test - Number of blows per foot.
  - Shelby Tube - Three (3) inch nominal diameter tube hydraulically pushed.
- P. P. = Pocket Penetrometer (tons/s.f.).
- NR = No recovery.
- GWT  = Ground Water Table observed @ specified time.

**LANDMARK**  
Geo-Engineers and Geologists

Project No. LE10093

Key to Logs

Plate  
B-16

## **APPENDIX C**

# LANDMARK CONSULTANTS, INC.

**CLIENT:** CSOLAR Development, LLC

**PROJECT:** Imperial Valley West Solar Farm

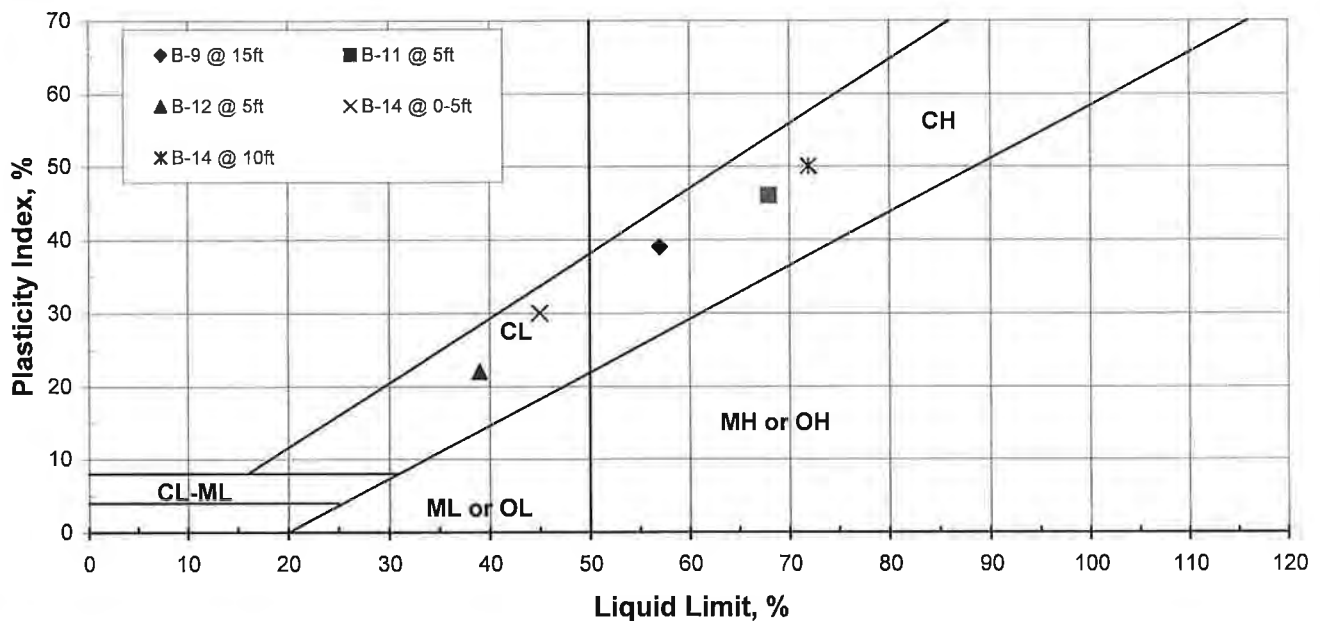
**JOB No.:** LE10093

**DATE:** 05/24/10

## ATTERBERG LIMITS (ASTM D4318)

Sample Location	Sample Depth (ft)	Liquid Limit (LL)	Plastic Limit (PL)	Plasticity Index (PI)	USCS Classification
B-9	15	57	18	39	CH
B-11	5	68	22	46	CH
B-12	5	39	17	22	CL
B-14	0-5	45	15	30	CL
B-14	10	72	22	50	CH

## PLASTICITY CHART




**LANDMARK**  
Geo-Engineers and Geologists

Project No.: LE10093

Atterberg Limits  
Test Results

Plate  
C-1

SIEVE ANALYSIS					HYDROMETER ANALYSIS
Gravel		Sand			Silt and Clay Fraction
Coarse	Fine	Coarse	Medium	Fine	

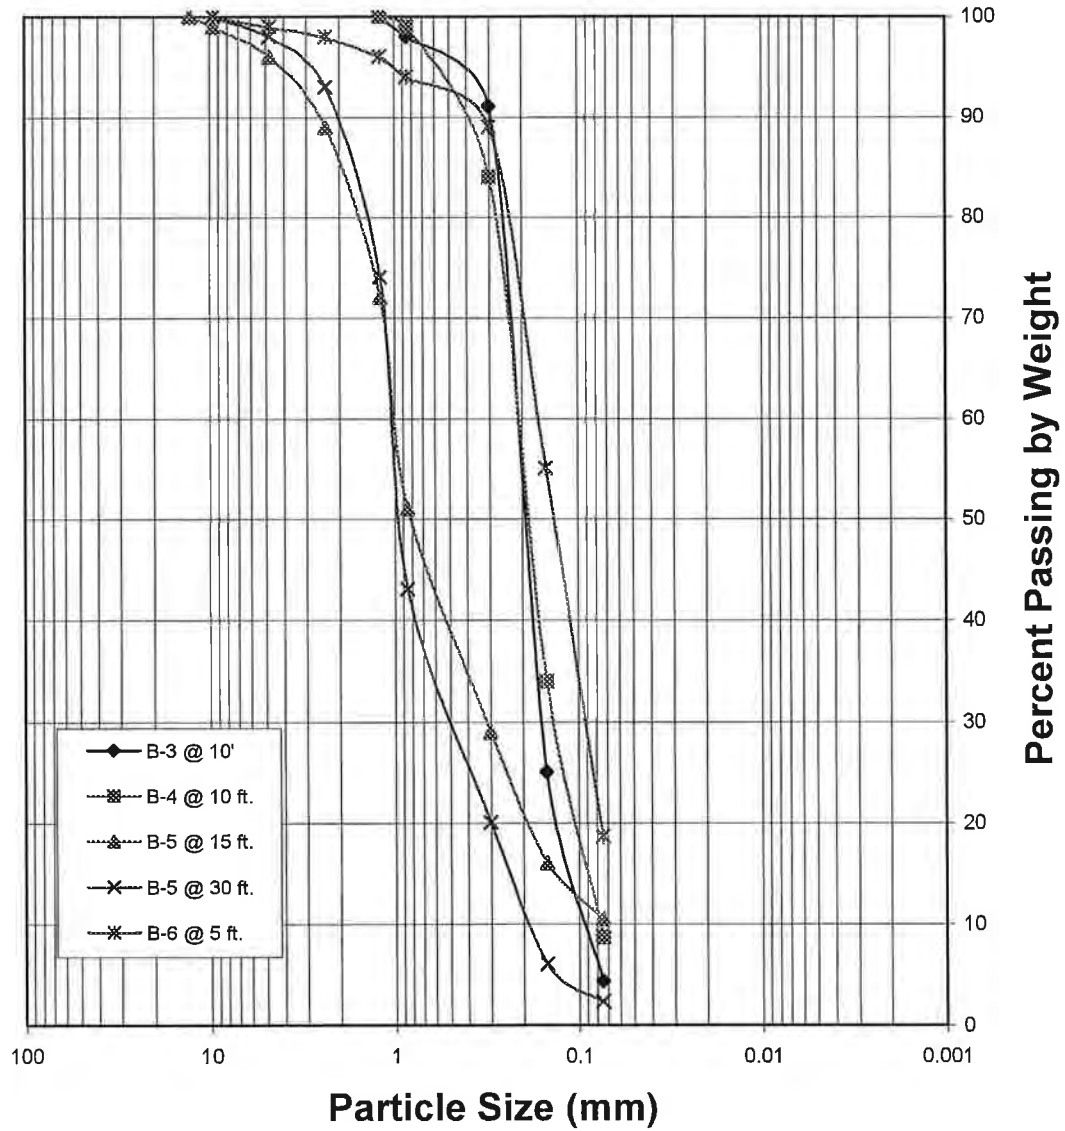


**LANDMARK**  
Geo-Engineers and Geologists

Project No.: LE10093

Grain Size Analysis

Plate  
C-2

SIEVE ANALYSIS					HYDROMETER ANALYSIS
Gravel		Sand			Silt and Clay Fraction
Coarse	Fine	Coarse	Medium	Fine	

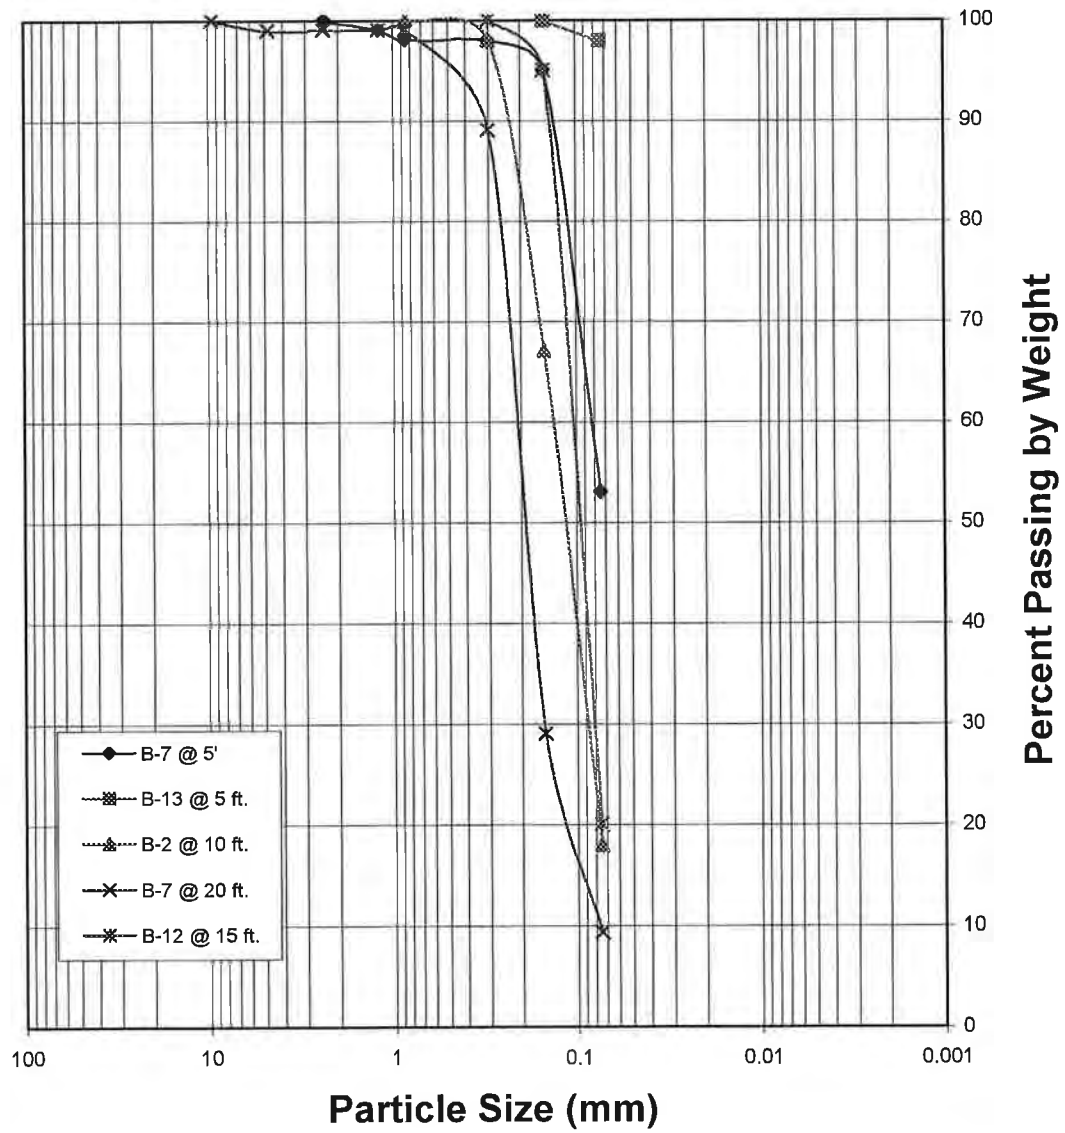




## LANDMARK CONSULTANTS, INC.

**CLIENT:** CSOLAR Development, LLC  
**PROJECT:** Imperial Valley West Solar Farm  
**JOB NO:** LE10093  
**DATE:** 05/21/10

### UNCONFINED COMPRESSION TEST (ASTM D2166)

Boring No.	Sample Depth (ft)	Natural Moisture Content (%)	Unit Dry Weight (pcf)	Maximum Compressive Strength (tsf)	Cohesion (tsf)	Failure Strain (%)
B-9	10.0	22.8	103.2	4.90	2.45	7.4
B-11	10.0	18.5	108.3	6.62	3.31	3.5
B-13	10.0	10.3	114.7	7.22	3.61	3.3

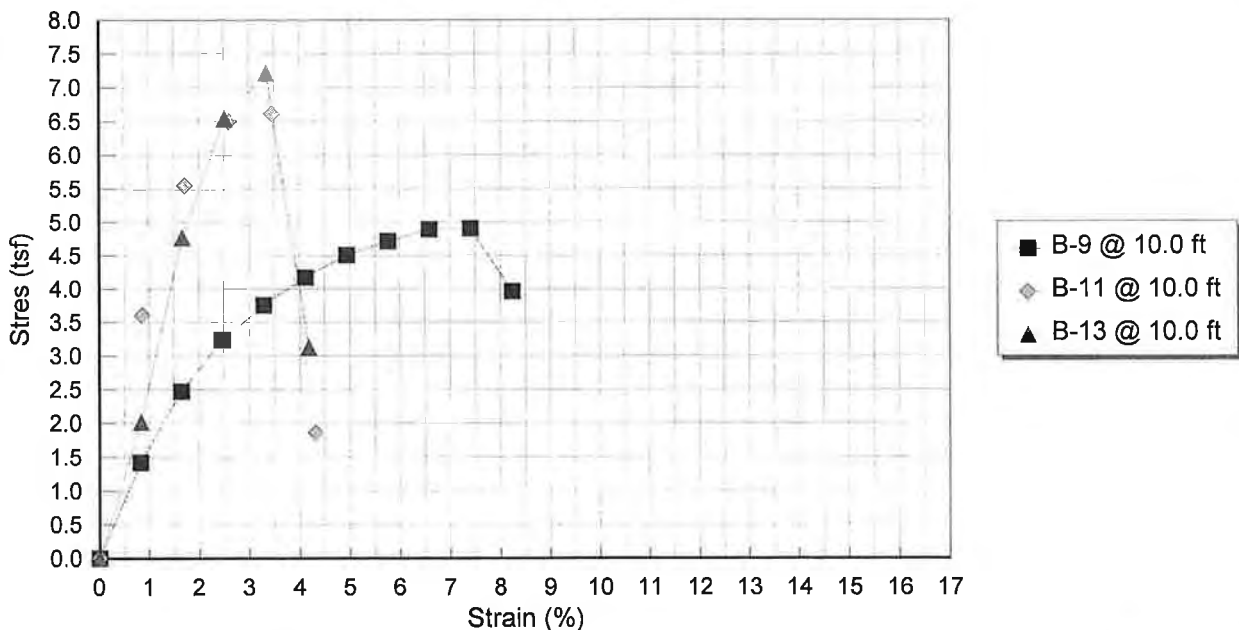STRESS-STRAIN PLOT



**LANDMARK**  
Geo-Engineers and Geologists

Project No: LE10093

Unconfined Compression  
Test Results

Plate  
C-4

## LANDMARK CONSULTANTS, INC.

**CLIENT:** CSOLAR Development, LLC

**PROJECT:** Imperial Valley West Solar Farm

**JOB No.:** LE10093

**DATE:** 05/24/10

### CHEMICAL ANALYSIS

Boring: Sample Depth, ft:	B-2 0-5	B-4 0-5	B-6 0-5	B-7 0-5	Caltrans Method
pH:	7.7	7.8	7.9	7.8	643
Electrical Conductivity (mmhos):	0.68	0.3	0.24	0.25	424
Resistivity (ohm-cm):	700	2100	2400	2000	643
Chloride (Cl), ppm:	420	80	40	100	422
Sulfate (SO <sub>4</sub> ), ppm:	346	2	1	0	417

#### General Guidelines for Soil Corrosivity

Material Affected	Chemical Agent	Amount in Soil (ppm)	Degree of Corrosivity
Concrete	Soluble Sulfates	0 - 1,000	Low
		1,000 - 2,000	Moderate
		2,000 - 20,000	Severe
		> 20,000	Very Severe
Normal Grade Steel	Soluble Chlorides	0 - 200	Low
		200 - 700	Moderate
		700 - 1,500	Severe
		> 1,500	Very Severe
Normal Grade Steel	Resistivity	1 - 1,000	Very Severe
		1,000 - 2,000	Severe
		2,000 - 10,000	Moderate
		> 10,000	Low

**LANDMARK**  
Geo-Engineers and Geologists

**Project No.:** LE10093

**Selected Chemical  
Test Results**

**Plate  
C-5**

## LANDMARK CONSULTANTS, INC.

**CLIENT:** CSOLAR Development, LLC  
**PROJECT:** Imperial Valley West Solar Farm  
**JOB No.:** LE10093  
**DATE:** 05/24/10

### CHEMICAL ANALYSIS

Boring: Sample Depth, ft:	B-10 0-5	B-11 0-5	B-13 0-5	B-14 0-5	Caltrans Method
pH:	8.2	7.6	8.6	7.6	643
Electrical Conductivity (mmhos):	0.22	2.89	0.65	2.33	424
Resistivity (ohm-cm):	2400	230	950	300	643
Chloride (Cl), ppm:	80	940	210	580	422
Sulfate (SO <sub>4</sub> ), ppm:	2	4,395	337	3,489	417

#### General Guidelines for Soil Corrosivity

Material Affected	Chemical Agent	Amount in Soil (ppm)	Degree of Corrosivity
Concrete	Soluble Sulfates	0 - 1,000	Low
		1,000 - 2,000	Moderate
		2,000 - 20,000	Severe
		> 20,000	Very Severe
Normal Grade Steel	Soluble Chlorides	0 - 200	Low
		200 - 700	Moderate
		700 - 1,500	Severe
		> 1,500	Very Severe
Normal Grade Steel	Resistivity	1 - 1,000	Very Severe
		1,000 - 2,000	Severe
		2,000 - 10,000	Moderate
		> 10,000	Low

**LANDMARK**  
Geo-Engineers and Geologists

**Project No.:** LE10093

**Selected Chemical  
Test Results**

**Plate  
C-6**

## **APPENDIX D**

## Liquefaction Evaluation and Settlement Calculation

Project Name: IV West Solar Site

Project No.: LE10093

Location: B-15

Maximum Credible Earthquake 7  
 Design Ground Motion 0.40 g  
 Total Unit Weight, 115 pcf  
 Water Unit Weight, 62.4 pcf  
 Depth to Groundwater 29 ft  
 Hammer Efficiency 90  
 Required Factor of Safety 1.0

Boring Data						Sampling Corrections							Corrected	Fines	SPT Clean	Cyclical	Cyclical	Factor	Volumetric	Induced
Depth		Blow Counts		Liquefiable	Overburden	Sampler	SPT	Energy	Borehole	Rod	Liner	Overburden	SPT	Content	Sands	Resistance	Stress	of	Strain (%)	Subsidence
(ft)	(m)	SPT	Mod. Cal.	Soil (0 / 1)	Pressure	Diameter	N <sub>m</sub>	C <sub>E</sub>	C <sub>B</sub>	C <sub>R</sub>	C <sub>L</sub>	C <sub>N</sub>	(N <sub>1</sub> ) <sub>60</sub>	%	(N <sub>1</sub> ) <sub>SDCS</sub>	CRR <sub>M7.5</sub>	CSR	Safety	(%)	(inch)
5	1.52		46	0	575	0.67	31	1.5	1.0	0.75	1	1.70	59	90	76		0.257	Non-Liq.	0.00	0.00
10	3.05	26		0	1150	1	26	1.5	1.0	0.80	1.1	1.36	47	95	61		0.255	Non-Liq.	0.00	0.00
15	4.57		48	0	1725	0.67	32	1.5	1.0	0.85	1	1.11	45	95	59		0.252	Non-Liq.	0.00	0.00
20	6.10	22		0	2300	1	22	1.5	1.0	0.95	1.1	0.96	33	95	45		0.249	Non-Liq.	0.00	0.00
25	7.62		100	0	2875	0.67	67	1.5	1.0	0.95	1	0.86	82	5	82		0.245	Non-Liq.	0.00	0.00
30	9.14	30		1	3388	1	30	1.5	1.0	0.95	1.1	0.78	37	5	37		0.244	Non-Liq.	0.00	0.00
35	10.67		100	1	3651	0.67	67	1.5	1.0	1.00	1	0.73	73	5	73		0.255	Non-Liq.	0.00	0.00
40	12.19	150		1	3914	1	150	1.5	1.0	1.00	1.1	0.68	168	23	189		0.260	Non-Liq.	0.00	0.00
45	13.72		100	0	4177	0.67	67	1.5	1.0	1.00	1	0.64	64	25	76		0.259	Non-Liq.	0.00	0.00
50	15.24	65		1	4440	1	65	1.5	1.0	1.00	1.1	0.61	65	25	77		0.253	Non-Liq.	0.00	0.00
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	83	#N/A	#N/A	#DIV/0!	#N/A	0.00	
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	83	#N/A	#N/A	#DIV/0!	#N/A	0.00	
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	95	#N/A	#N/A	#DIV/0!	#N/A	0.00	
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	95	#N/A	#N/A	#DIV/0!	#N/A	0.00	

Based on Proceeding of the NCEER Workshop on Evaluation of Liquefaction Resistance of Soils, Technical Report NCEER-97-0022, December 31, 1997.

Total Settlement

0.00

Corrections to SPT (Modified from Skempton, 1986) as listed by Robertson and Wride:

Factor	Equipment Variable	Term	Correction
Overburden Pressure		C <sub>N</sub>	$(P_a/\sigma_{v0})^{0.5}$ C <sub>N</sub> ≤ 2
Energy Ratio	Donut Hammer Safety Hammer Automatic-trip Donut type Hammer	C <sub>E</sub>	0.5 to 1.0 0.7 to 1.2 0.8 to 1.3
Borehole Diameter	2.6 inch to 6 inch 6 inch 8 inch	C <sub>B</sub>	1 1.05 1.15
Rod Length	10 feet to 13 feet 13 feet to 19.8 ft. 19.8 ft. to 33 ft. 33 ft. to 98 ft. > 98 ft.	C <sub>R</sub>	0.75 0.85 0.95 1 <1.0
Sampling Method	Standard Sampler Sampler without liners	C <sub>L</sub>	1 1.1 to 1.3

## Liquefaction Evaluation and Settlement Calculation

Project Name: IV West Solar Site

Project No.: LE10093

Location: B-8

Maximum Credible Earthquake 7  
 Design Ground Motion 0.40 g  
 Total Unit Weight, 115 pcf  
 Water Unit Weight, 62.4 pcf  
 Depth to Groundwater 8 ft  
 Hammer Efficiency 90  
 Required Factor of Safety 1.0

Boring Data						Sampling Corrections						Corrected	Fines	SPT Clean	Cyclical	Cyclical	Factor	Volumetric	Induced	
Depth		Blow Counts		Liquefiable	Overburden	Sampler	SPT	Energy	Borehole	Rod	Liner	Overburden	SPT	Content	Sands	Resistance	Stress	of	Strain (%)	Subsidence
(ft)	(m)	SPT	Mod. Cal.	Soil (0 / 1)	Pressure	Diameter	N <sub>m</sub>	C <sub>E</sub>	C <sub>B</sub>	C <sub>R</sub>	C <sub>L</sub>	C <sub>N</sub>	(N <sub>1</sub> ) <sub>60</sub>	%	(N <sub>1</sub> ) <sub>SPTCS</sub>	CRR <sub>M7.5</sub>	CSR	Safety		(inch)
5	1.52	18		0	575	1	18	1.5	1.0	0.75	1.1	1.70	38	90	50		0.257	Non-Liq.	0.00	0.00
10	3.05		35	0	1025	0.67	23	1.5	1.0	0.80	1	1.36	38	95	51		0.286	Non-Liq.	0.00	0.00
15	4.57	17		0	1288	1	17	1.5	1.0	0.85	1.1	1.11	26	95	37		0.337	Non-Liq.	0.00	0.00
20	6.10		25	0	1551	0.67	17	1.5	1.0	0.95	1	0.96	23	95	32		0.369	Non-Liq.	0.00	0.00
25	7.62	30		0	1814	1	30	1.5	1.0	0.95	1.1	0.86	40	95	53		0.388	Non-Liq.	0.00	0.00
30	9.14		100	1	2077	0.67	67	1.5	1.0	0.95	1	0.78	75	5	75		0.398	Non-Liq.	0.00	0.00
35	10.67	53		1	2340	1	53	1.5	1.0	1.00	1.1	0.73	63	5	63		0.398	Non-Liq.	0.00	0.00
40	12.19		100	1	2603	0.67	67	1.5	1.0	1.00	1	0.68	68	15	74		0.391	Non-Liq.	0.00	0.00
45	13.72	29		0	2866	1	29	1.5	1.0	1.00	1.1	0.64	31	90	42		0.377	Non-Liq.	0.00	0.00
50	15.24	65		1	3129	1	65	1.5	1.0	1.00	1.1	0.61	65	20	74		0.360	Non-Liq.	0.00	0.00
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	83	#N/A	#N/A	#DIV/0!	#N/A	0.00	
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	83	#N/A	#N/A	#DIV/0!	#N/A	0.00	
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	95	#N/A	#N/A	#DIV/0!	#N/A	0.00	
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	95	#N/A	#N/A	#DIV/0!	#N/A	0.00	

Based on *Proceeding of the NCEER Workshop on Evaluation of Liquefaction Resistance of Soils*, Technical Report NCEER-97-0022, December 31, 1997.

Total Settlement

0.00

Corrections to SPT (Modified from Skempton, 1986) as listed by Robertson and Wride.

Factor	Equipment Variable	Term	Correction
Overburden Pressure		C <sub>N</sub>	$(P_v/\sigma_{v0})^{0.5}$ C <sub>N</sub> ≤ 2
Energy Ratio	Donut Hammer Safety Hammer Automatic-trip Donut type Hammer	C <sub>E</sub>	0.5 to 1.0 0.7 to 1.2 0.8 to 1.3
Borehole Diameter	2.6 inch to 6 inch 6 inch 8 inch	C <sub>B</sub>	1 1.05 1.15
Rod Length	10 feet to 13 feet 13 feet to 19.8 ft. 19.8 ft. to 33 ft. 33 ft. to 98 ft. > 98 ft.	C <sub>R</sub>	0.75 0.85 0.95 1 <1.0
Sampling Method	Standard Sampler Sampler without liners	C <sub>L</sub>	1 1.1 to 1.3

## Liquefaction Evaluation and Settlement Calculation

**Project Name:** IV West Solar Site

**Project No.:** LE10093

**Location:** B-7

Maximum Credible Earthquake 7  
 Design Ground Motion 0.40 g  
 Total Unit Weight, 115 pcf  
 Water Unit Weight, 62.4 pcf  
 Depth to Groundwater 49 ft  
 Hammer Efficiency 90  
 Required Factor of Safety 1.0

Boring Data						Sampling Corrections							Corrected	Fines	SPT Clean	Cyclical	Cyclical	Factor	Volumetric	Induced
Depth		Blow Counts		Liquefiable	Overburden	Sampler	SPT	Energy	Borehole	Rod	Liner	Overburden	SPT	Content	Sands	Resistance	Stress	of	Strain (%)	Subsidence
(ft)	(m)	SPT	Mod. Cal.	Soil (0 / 1)	Pressure	Diameter	N <sub>m</sub>	C <sub>E</sub>	C <sub>B</sub>	C <sub>R</sub>	C <sub>L</sub>	C <sub>N</sub>	(N <sub>1</sub> ) <sub>60</sub>	%	(N <sub>1</sub> ) <sub>60CS</sub>	CRR <sub>M7.5</sub>	CSR	Safety		(inch)
5	1.52	16		1	575	1	16	1.5	1.0	0.75	1.1	1.70	34	53	45		0.257	Non-Liq.	0.00	0.00
10	3.05		100	1	1150	0.67	67	1.5	1.0	0.80	1	1.36	109	53	136		0.255	Non-Liq.	0.00	0.00
15	4.57		76	1	1725	0.67	51	1.5	1.0	0.85	1	1.11	72	50	91		0.252	Non-Liq.	0.00	0.00
20	6.10	37		1	2300	1	37	1.5	1.0	0.95	1.1	0.96	56	9	57		0.249	Non-Liq.	0.00	0.00
25	7.62	38		1	2875	1	38	1.5	1.0	0.95	1.1	0.86	51	9	53		0.245	Non-Liq.	0.00	0.00
30	9.14	49		1	3450	1	49	1.5	1.0	0.95	1.1	0.78	60	9	62		0.239	Non-Liq.	0.00	0.00
35	10.67	100		1	4025	1	100	1.5	1.0	1.00	1.1	0.73	120	10	123		0.232	Non-Liq.	0.00	0.00
40	12.19	100		1	4600	1	100	1.5	1.0	1.00	1.1	0.68	112	10	115		0.221	Non-Liq.	0.00	0.00
45	13.72	100		1	5175	1	100	1.5	1.0	1.00	1.1	0.64	106	10	109		0.209	Non-Liq.	0.00	0.00
50	15.24	100		1	5688	1	100	1.5	1.0	1.00	1.1	0.61	100	55	125		0.198	Non-Liq.	0.00	0.00
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	83	#N/A	#N/A	#DIV/0!	#N/A	0.00	
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	83	#N/A	#N/A	#DIV/0!	#N/A	0.00	
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	95	#N/A	#N/A	#DIV/0!	#N/A	0.00	
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	95	#N/A	#N/A	#DIV/0!	#N/A	0.00	

Based on *Proceeding of the NCEER Workshop on Evaluation of Liquefaction Resistance of Soils*, Technical Report NCEER-97-0022, December 31, 1997.

Total Settlement

0.00

Corrections to SPT (Modified from Skempton, 1986) as listed by Robertson and Wride.

Factor	Equipment Variable	Term	Correction
Overburden Pressure		C <sub>N</sub>	$(P_a/\sigma_{v0})^{0.5}$ C <sub>N</sub> ≤ 2
Energy Ratio	Donut Hammer Safety Hammer Automatic-trip Donut type Hammer	C <sub>E</sub>	0.5 to 1.0 0.7 to 1.2 0.8 to 1.3
Borehole Diameter	2.6 inch to 6 inch 6 inch 8 inch	C <sub>B</sub>	1 1.05 1.15
Rod Length	10 feet to 13 feet 13 feet to 19.8 ft. 19.8 ft. to 33 ft. 33 ft. to 98 ft. > 98 ft.	C <sub>R</sub>	0.75 0.85 0.95 1 <1.0
Sampling Method	Standard Sampler Sampler without liners	C <sub>L</sub>	1 1.1 to 1.3

## Liquefaction Evaluation and Settlement Calculation

**Project Name:** IV West Solar Site

**Project No.:** LE10093

**Location:** B-5

Maximum Credible Earthquake 7  
 Design Ground Motion 0.40 g  
 Total Unit Weight, 115 pcf  
 Water Unit Weight, 62.4 pcf  
 Depth to Groundwater 18 ft  
 Hammer Efficiency 90  
 Required Factor of Safety 1.0

Boring Data						Sampling Corrections							Corrected	Fines	SPT Clean	Cyclical	Cyclical	Factor	Volumetric	Induced
Depth		Blow Counts		Liquefiable	Overburden	Sampler	SPT	Energy	Borehole	Rod	Liner	Overburden	SPT	Content	Sands	Resistance	Stress	of	Strain (%)	Subsidence
(ft)	(m)	SPT	Mod. Cal.	Soil (0 / 1)	Pressure	Diameter	N <sub>m</sub>	C <sub>E</sub>	C <sub>B</sub>	C <sub>R</sub>	C <sub>L</sub>	C <sub>N</sub>	(N <sub>1</sub> ) <sub>60</sub>	%	(N <sub>1</sub> ) <sub>60CS</sub>	CRR <sub>M7.5</sub>	CSR	Safety		
5	1.52		39	0	575	0.67	26	1.5	1.0	0.75	1	1.70	50	3	50		0.257	Non-Liq.	0.00	0.00
10	3.05		100	0	1150	0.67	67	1.5	1.0	0.80	1	1.36	109	30	131		0.255	Non-Liq.	0.00	0.00
15	4.57	31		1	1725	1	31	1.5	1.0	0.85	1.1	1.11	48	2	48		0.252	Non-Liq.	0.00	0.00
20	6.10		76	1	2175	0.67	51	1.5	1.0	0.95	1	0.96	70	2	70		0.263	Non-Liq.	0.00	0.00
25	7.62	22		0	2438	1	22	1.5	1.0	0.95	1.1	0.86	30	95	41		0.289	Non-Liq.	0.00	0.00
30	9.14	13		1	2701	1	13	1.5	1.0	0.95	1.1	0.78	16	10	17	0.185	0.306	0.72	1.72	1.03
35	10.67	60		1	2964	1	60	1.5	1.0	1.00	1.1	0.73	72	10	74		0.314	Non-Liq.	0.00	0.00
40	12.19	11		0	3227	1	11	1.5	1.0	1.00	1.1	0.68	12	88	20	0.214	0.315	0.81	0.00	0.00
45	13.72	8		0	3490	1	8	1.5	1.0	1.00	1.1	0.64	8	88	15	0.164	0.310	0.63	0.00	0.00
50	15.24	23		0	3753	1	23	1.5	1.0	1.00	1.1	0.61	23	0	23	0.253	0.300	1.01	0.00	0.00
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	83	#N/A	#N/A	#DIV/0!	#N/A	0.00	
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	83	#N/A	#N/A	#DIV/0!	#N/A	0.00	
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	95	#N/A	#N/A	#DIV/0!	#N/A	0.00	
	0.00			0	0	0.67	0	1.5	1.0	#N/A	1	#DIV/0!	#N/A	95	#N/A	#N/A	#DIV/0!	#N/A	0.00	

Based on Proceeding of the NCEER Workshop on Evaluation of Liquefaction Resistance of Soils, Technical Report NCEER-97-0022, December 31, 1997

Total Settlement

1.03

Corrections to SPT (Modified from Skempton, 1986) as listed by Robertson and Wride.

Factor	Equipment Variable	Term	Correction
Overburden Pressure		C <sub>N</sub>	$(P_w/\sigma_{v0})^{0.5}$ C <sub>N</sub> ≤ 2
Energy Ratio	Donut Hammer Safety Hammer Automatic-trip Donut type Hammer	C <sub>E</sub>	0.5 to 1.0 0.7 to 1.2 0.8 to 1.3
Borehole Diameter	2.6 inch to 6 inch 6 inch 8 inch	C <sub>B</sub>	1 1.05 1.15
Rod Length	10 feet to 13 feet 13 feet to 19.8 ft. 19.8 ft. to 33 ft. 33 ft. to 98 ft. > 98 ft.	C <sub>R</sub>	0.75 0.85 0.95 1 <1.0
Sampling Method	Standard Sampler Sampler without liners	C <sub>L</sub>	1 1.1 to 1.3



## **APPENDIX E**

## REFERENCES

- American Society of Civil Engineers (ASCE), 2005, Minimum Design Loads for Buildings and Other Structures: ASCE Standard 7-05.
- Arango I., 1996, Magnitude Scaling Factors for Soil Liquefaction Evaluations: ASCE Geotechnical Journal, Vol. 122, No. 11.
- Blake, T. F., 2000, FRISKSP - A computer program for the probabilistic estimation of seismic hazard using faults as earthquake sources.
- Boore, D. M., Joyner, W. B., and Fumal, T. E., 1997, Empirical Near-Source Attenuation Relationships for Horizontal and Vertical Components of Peak Ground Acceleration, Peak Ground Velocity, and Pseudo-Absolute Acceleration Response Spectra: Seismological Research Letters, Vol. 68, No. 1, p. 154-179.
- Bray, J. D., Sancio, R. B., Riemer, M. F. and Durgunoglu, T., (2004), Liquefaction Susceptibility of Fine-Grained Soils: Proc. 11th Inter. Conf. in Soil Dynamics and Earthquake Engineering and 3<sup>rd</sup> Inter. Conf. on Earthquake Geotechnical Engineering., Doolin, Kammerer, Nogami, Seed, and Towhata, Eds., Berkeley, CA, Jan. 7-9, V.1, pp. 655-662.
- California Building Standards Commission, 2007, 2007 California Building Code. California Code of Regulations, Title 24, Part 2, Vol. 2 of 2.
- California Division of Mines and Geology (CDMG), 1996, California Fault Parameters: available at <http://www.consrv.ca.gov/dmg/shezp/ftindex.html>
- California Division of Mines and Geology (CDMG), 1962, Geologic Map of California – San Diego-El Centro Sheet: California Division of Mines and Geology, Scale 1:250,000.
- Cao, T., Bryant, W. A., Rowshandel, B., Branum, D., and Wills, C. J., 2003, The revised 2002 California probabilistic seismic hazards maps: California Geological Survey: <http://www.conservation.ca.gov/cgs/rghm/psha>.
- Cetin, K. O., Seed, R. B., Der Kiureghian, A., Tokimatsu, K., Harder, L. F., Jr., Kayen, R. E., and Moss, R. E. S., 2004, Standard penetration test-based probabilistic and deterministic assessment of seismic soil liquefaction potential: ASCE JGGE, Vol., 130, No. 12, p. 1314-1340.
- Dibblee, T. W., 1954, Geology of the Imperial Valley region, California, in: Jahns, R. H., ed., Geology of Southern California: California Division of Mines Bull. 170, p. 21-28.

- Ellsworth, W. L., 1990, Earthquake History, 1769-1989 in: The San Andreas Fault System, California: U.S. Geological Survey Professional Paper 1515, 283 p.
- International Code Council (ICC), 2006, International Building Code, 2006 Edition.
- Ishihara, K. (1985), Stability of natural deposits during earthquakes, Proc. 11<sup>th</sup> Int. Conf. On Soil Mech. And Found. Engrg., Vol. 1, A. A. Balkema, Rotterdam, The Netherlands, 321-376.
- Jennings, C. W., 1994, Fault activity map of California and Adjacent Areas: California Division of Mines and Geology, DMG Geologic Map No. 6.
- Jones, A. L., 2003, An Analytical Model and Application for Ground Surface Effects from Liquefaction, PhD. Dissertation, University of Washington, 362 p.
- Jones, L. and Hauksson, E., 1994, Review of potential earthquake sources in Southern California: Applied Technology Council, Proceedings of ATC 35-1.
- Morton, P. K., 1977, Geology and mineral resources of Imperial County, California: California Division of Mines and Geology, County Report No. 7, 104 p.
- Mualchin, L. and Jones, A. L., 1992, Peak acceleration from maximum credible earthquakes in California (Rock and Stiff Soil Sites): California Division of Mines and Geology, DMG Open File Report 92-01.
- Naeim, F. and Anderson, J. C., 1993, Classification and evaluation of earthquake records for design: Earthquake Engineering Research Institute, NEHRP Report.
- National Research Council, Committee of Earthquake Engineering, 1985, Liquefaction of Soils during Earthquakes: National Academy Press, Washington, D.C.
- Post-Tensioning Institute (PTI), 2004, Design of Post-Tensioned Slabs-on-Ground. 106 p.
- Post-Tensioning Institute (PTI), 2007, Standard Requirements for Design of Shallow Post-Tensioned Concrete Foundations on Expansive Soils. 16 p.
- Robertson, P. K. and Wride, C. E., 1996, Cyclic Liquefaction and its Evaluation based on the SPT and CPT, Proceeding of the NCEER Workshop on Evaluation of Liquefaction Resistance of Soils, NCEER Technical Report 97-0022, p. 41-88.
- Seed, Harry B., Idriss, I. M., and Arango I., 1983, Evaluation of liquefaction potential using field performance data: ASCE Geotechnical Journal, Vol. 109, No. 3.
- Seed, Harry B., et al, 1985, Influence of SPT Procedures in Soil Liquefaction Resistance Evaluations: ASCE Geotechnical Journal, Vol. 113, No. 8.

- Seed, R. B., Cetin, K. O., Moss, R. E. S., Kammerer, A. M., Wu, J., Pestana, J. M., Riemer, M. F., Sancio, R. B., Bray, J. D., Kayen, R. E., and Faris, A., 2003, Recent advances in soil liquefaction engineering: a unified and consistent framework: University of California, Earthquake Engineering Research Center Report 2003-06, 71 p.
- Sharp, R. V., 1982, Tectonic setting of the Imperial Valley region: U.S. Geological Survey Professional Paper 1254, p. 5-14.
- Sylvester, A. G., 1979, Earthquake damage in Imperial Valley, California May 18, 1940, as reported by T. A. Clark: Bulletin of the Seismological Society of America, v. 69, no. 2, p. 547-568.
- Tokimatsu, K. and Seed H. B., 1987, Evaluation of settlements in sands due to earthquake shaking: ASCE Geotechnical Journal, v. 113, no. 8.
- U.S. Geological Survey (USGS), 1982, The Imperial Valley California Earthquake of October 15, 1979: Professional Paper 1254, 451 p.
- U.S. Geological Survey (USGS), 1990, The San Andreas Fault System, California, Professional Paper 1515.
- U.S. Geological Survey (USGS), 1996, National Seismic Hazard Maps: available at <http://gldage.cr.usgs.gov>
- U.S. Geological Survey (USGS), 2007, Earthquake Ground Motion Parameters, Version 5.0.7: available at <http://earthquake.usgs.gov/research/hazmaps/design/>
- Wire Reinforcement Institute (WRI), 2003, Design of Slab-on-Ground Foundations, Tech Facts TF 700-R-03, 23 p.
- Working Group on California Earthquake Probabilities (WGCEP), 1992, Future seismic hazards in southern California, Phase I Report: California Division of Mines and Geology.
- Working Group on California Earthquake Probabilities (WGCEP), 1995, Seismic hazards in southern California, Probable Earthquakes, 1994-2014, Phase II Report: Southern California Earthquake Center.
- Youd, T. L., 2005, Liquefaction-induced flow, lateral spread, and ground oscillation, GSA Abstracts with Programs, Vol. 37, No. 7, p. 252.
- Youd, T. L. and Garriss, C. T., 1995, Liquefaction induced ground surface disruption: ASCE Geotechnical Journal, Vol. 121, No. 11.

Youd, T. L., Hansen, C. M., and Bartlett, S. F., 1995, Revised Multilinear Regression Equations of Prediction of Lateral Spread Displacement: Journal of Geotechnical and Geoenvironmental Engineering, Vol. 128, No. 12, p. 1007-1017.

Youd, T. L. et. al., 2001, Liquefaction Resistance of Soils: Summary Report from the 1996 NCEER and 1998 NCEER/NSF Workshops on Evaluation of Liquefaction Resistance of Soils: Journal of Geotechnical and Geoenvironmental Engineering, Vol. 127, No. 10, p. 817-833.

Zimmerman, R. P., 1981, Soil survey of Imperial County, California, Imperial Valley Area: U.S. Dept. of Agriculture Soil Conservation Service, 112 p.